## Angel plug for semi-rigid cable

## Cable entry:

 
Center contact - soldered Braid - crimp

Series: MCX











 1. Prepare the cable according to the diagram.



- 2. Slide ferrule "A" onto the cable.
- 3. Splay out the braid.

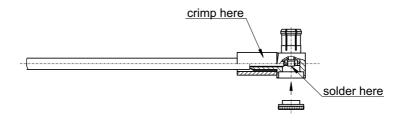

- 4. Insert the prepared cable into the connector body "B". Position the inner conductor of the cable in the slot of the center pin. Ensure that the braid covers the knurled connector end.
- 5. Slide ferrule "A" over the braid up to the connector body and crimp as close to the connector body as possible. \*)
- 6. Solder the center pin to the inner conductor of the cable.
- 7. Press cover "C" into the rear operture of the connector body.
  - \*) For the crimping die part-no. please consult the relevant customer drawing.

				Rosenberger Hochfrequenztechnik 84526 Tittmoning			
				Bearb.	27.02.96	Krautenb.Sa.	M 2:1
а	CAD-MTP	27.02.96	Kra.Sa.	Gepr.			Blatt 1/1
Zust.	Änderung	Datum	Name				

## Tools:

Strippingtool Crimp tool 11 W 150-000 Soldering equipment