


Slide nut A, washer B and gasket C over cable. Remove carefully 26 mm of cable jacket without damaging or opening the braid.

Armoured cable


Slide armour nut instead of nut A over cable. Remove 55,5 mm of armour.

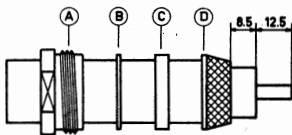

Position clamp D so that its shoulder fits against cable jacket. Fold braid back over clamp D and cut it off in front of the clamp rim. Cut off dielectric even and perpendicular to cable axis, observing the distance of 8,5 mm from the end of the braid. File edge of protruding center conductor.




Insert connector body as much as possible so that it butts tightly. Screw in nut A and tighten it with wrenches size 27 mm. Do not distort cable and connector body.

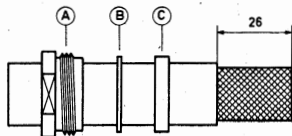

Nippel A, Scheibe B, Gummidichtung C auf das Kabel schieben. Mantel 26 mm zurückschneiden, ohne die Abschirmung zu verletzen oder zu öffnen.

Armierter Kabel:

Armierungsklemme anstelle des Nippels A auf das Kabel schieben. Armierung 55,5 mm zurückschneiden.

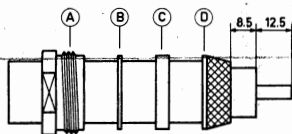

Klemmring D bis zum Anschlag am Kabelmantel aufschieben. Geflecht über den Klemmring zurückstülpen und bis vor den Rand des Klemmrings abschneiden. Dielektrikum glatt und senkrecht zur Kabelachse zurückschneiden und auf Einhaltung des Abstandes 8,5 mm vom Geflechtsrand achten. Kante des vorstehenden Innenleiters brechen.



Steckergehäuse so weit als möglich aufschieben und fest anpressen. Nippel A einschrauben und mit Gabelschlüsseln 27 mm anziehen. Kabel und Steckergehäuse nicht verdrehen.