


## EZ-400-NF (stock code: 3190-956) Type N Jack


Non-solder center contact Crimp-on (.429" hex.) outer contact

## INSTALLATION INSTRUCTIONS


(Cable Types: LMR-400; 400 DB; 400 FR)

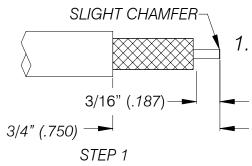

- 1. (A) Trim cable to dimensions shown using a razor knife.
  - (B) Remove any residual plastic from center conductor.
  - (C) Deburr center conductor using a fine file or Times DBT-01 tool.

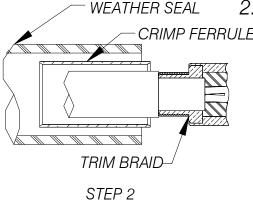

 - 2. (A) Slide weather seal and crimp ferrule over cable.
- CRIMP FERRULE (B) Flare braid and insert cable into connector body until dielectric is seated and center conductor is inserted fully into connector center pin.
  - (C) Trim excess braid flush to shoulder on connector.



- 3. (A) Slide crimp ferrule over braid and crimp as close to body as possible using a .429 hex. die in a Times HX-4 crimp tool or equivalent. Do not crimp rear of crimp ferrule.
  - (B) Heat shrink weather seal over rear of connector body and down on to cable jacket using hot air gun.