



Assembly instruction


Series BNC, TNC, N v8 No.3015

Tools and materials required: Stanley blade Scissors Crimp tool (see table below)		Straight connectors for flexible cable		
		Cable entry: SUHNER Full-Crimp		
		Connector types: (e. g.)		
		11 BNC-50-3-4	11 BNC-50-4-4	11 BNC-75-5-6
		21 BNC-50-3-2	21 BNC-50-4-1	21 BNC-75-5-3
		11 TNC-50-3-9	11 TNC-50-4-7	
		21 TNC-50-3-7	21 TNC-50-4-6	
		11 N-50-3-28	11 BNC-75-4-4	
This connector is supplied in 3 parts	Suitable cables e. g.:	RG 58 C/U	RG 59 B/U	G 05133 d
	Centre contact:	cavity 2	cavity 2	cavity 2
	Braid:	cavity B	cavity C	cavity 8,0
	Crimp tool:	2B (orange)	2C (yellow)	2/8,0

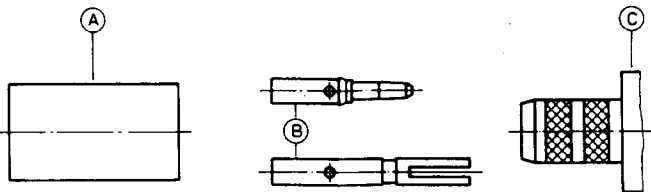


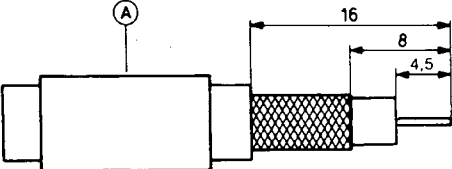


Slide ferrule A onto cable.
Prepare cable according to diagram.
CAUTION: Do not damage braid, dielectric and inner conductor of cable!

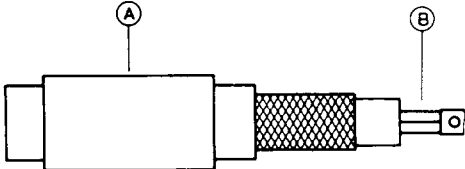


Push contact B over inner conductor of cable to abut dielectric and crimp.

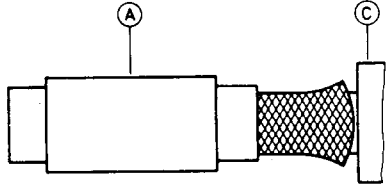

Splay out braid and insert cable in connector body C. Ensure that braid lies above the crimp neck.

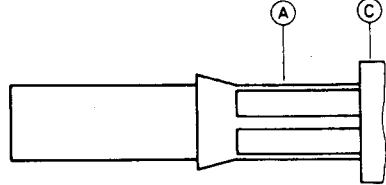

Slide ferrule A over braid and crimp as close to connector body C as possible.

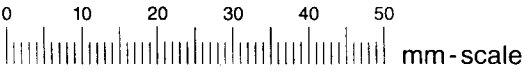

SUHNER's skilled staff and specialised equipment are available to carry out complete R. F. lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.