

Assembly instruction Series BNC v11 No.27001

Tools and materials required:

Stanley-blade

Scissors

Crimp insert : 76 Z 0 - 2 - 8

(for lage crimp tool and table press)

Straight connectors for flexible cables

Cable entry : SUHNER Full-Crimp

Connector types : (e.g.)

11 BNC 75-2-17

24 BNC 75-2-15

25 BNC 75-2-14

24 BNC 75-2-14

25 BNC 75-2-13

This connector
is supplied
in 3 parts

Centre contact :





cavity 1

Braid :

cavity 4,95

Crimp tool :

 
4,95

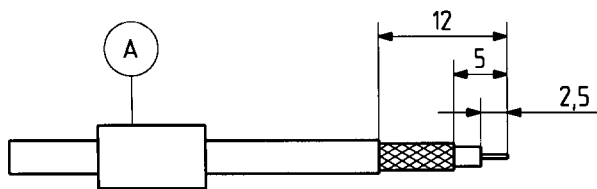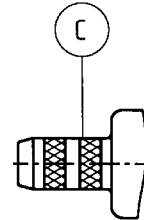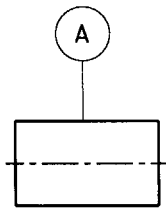


Slide ferrule A onto cable.

Prepare cable according to diagram.

CAUTION: Do not damage braid, dielectric and inner conductor of cable.

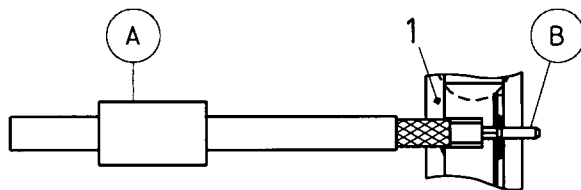


Push contact B over inner conductor of cable to about cable-dielectric and crimp with cavity 1.

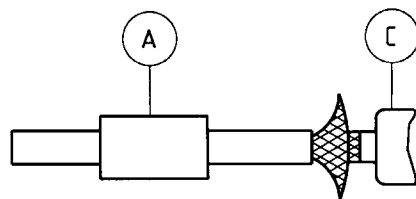

Splay out braid and insert cable in connector body C.

Ensure that braid lies above the crimp neck.

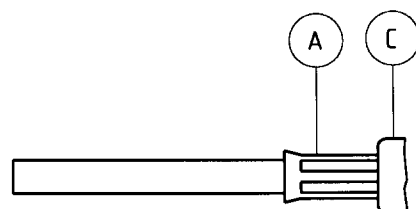

Slide ferrule A over braid and crimp

to connector body C as close as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F.lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text siehe Rückseite