

Assembly instruction Series N ^{UB} No. 27035

Tools and materials required:

Stanley blade

Scissors

Crimp tool (see table below)

Straight connectors for flexible cables

Cable entry: SUHNER Full-Crimp

Connector types: (e.g.)

11 N 50 - 6 - 1c

This connector
is supplied
in 3 parts

Suitable cables e.g.:

S 06132 D

Centre contact:





cavity 3

Braid:


cavity D

Crimp tool:


3 D (violett)

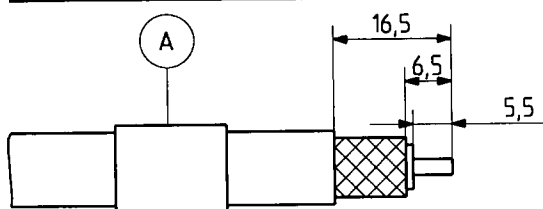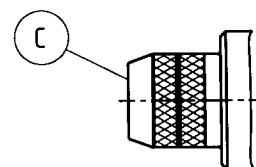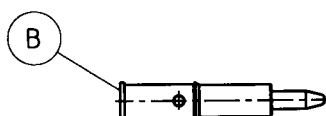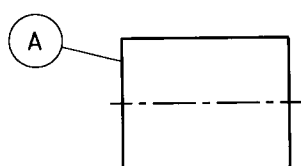


Slide ferrule A onto cable.
Prepare cable according to diagram.
CAUTION: Remove Aluminium type
between the two braided screens.

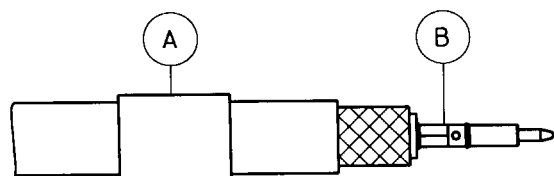

Push contact B over inner conductor of
cable to about cable-dielectric and
crimp with insert 3.

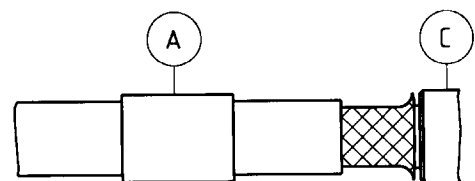

Splay out braid and insert cable in connector
body C until contact B engages perceptibly.
Ensure that braid lies above the crimp neck.

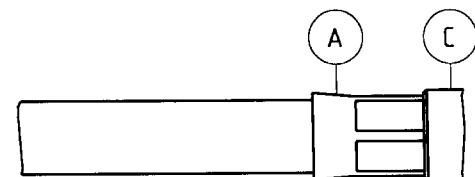

Slide ferrule A over braid and crimp
as close to connector body C as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F. lead-assembly on your behalf.
We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text: Siehe Rückseite