

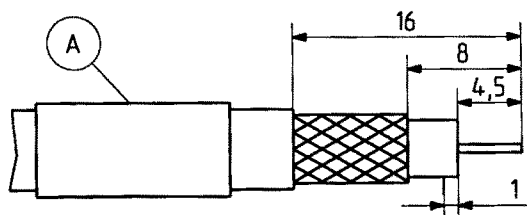
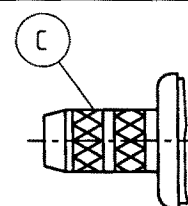
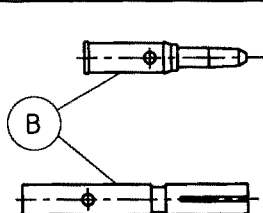


# Assembly instruction Series BNC, TNC<sup>U11</sup> No. 27057


Tools and materials required:		Straight connectors for flexible cable
Stanley blade Scissors Crimp tool (see table below)		Cable entry: SUHNER Full-Crimp
		Connector types: (e.g.) 11 BNC 50 - 3 - 36c    21 BNC 50 - 3 - 6c 11 TNC 75 - 3 - 9c    24 BNC 50 - 3 - 6c
This connector is supplied in 3 parts.	Suitable cables:	G 03130 HT
	Centre contact:	cavity 2
	Braid:	cavity C
	Crimp tool:	2C (yellow)

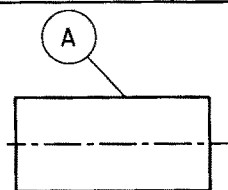


Slide ferrule A onto cable.  
Prepare cable according to diagram.  
CAUTION: Do not damage braid, dielectric and inner conductor of cable!  
Remove semiconducting layer 1mm towards braid.

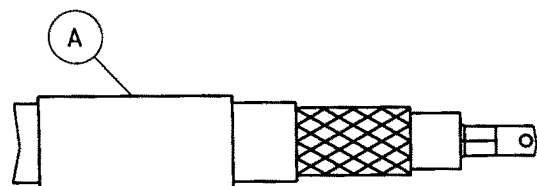

Push contact B over inner conductor of cable to abut dielectric and crimp.

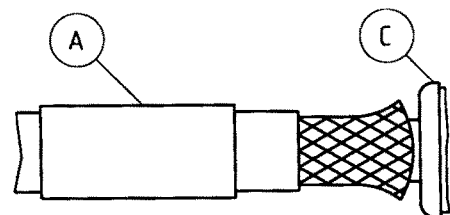

Splay out braid and insert cable in connector body C. Ensure that braid lies above the crimp neck.

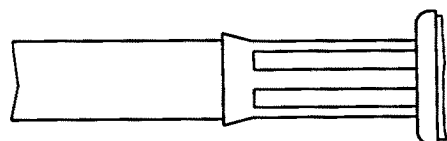

Slide ferrule A over braid and crimp as close to connector body C as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F.lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text: siehe Rückseite