

Assembly instructions Series N No. 27261

Tools and material required :

Stanley blade
Scissors
Crimp tool (see table below)
Spanner 13 mm

Straight connector for flexible cables

Cable entry : Suhner crimp

Connector types : (e.g.)

11 N - 50 - 6 - 9

This connector
is supplied
in 5 parts

Suitable cable :

S 06162 D-02

Centre contact :



plugged-in

Braid :

cavity 8,65

Crimp tool :

76 Z-0-6-1

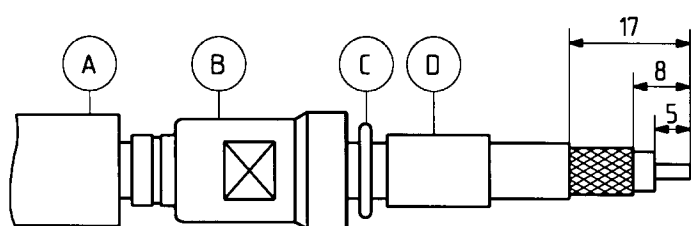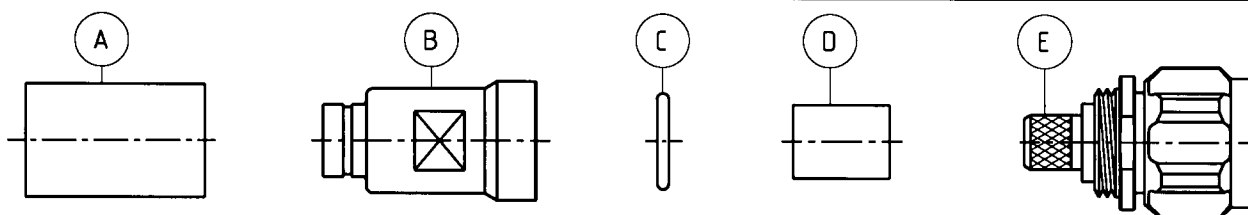


Slide shrink-tube A, body B, o-ring C and ferrule D onto cable.

Prepare cable according to diagram.

CAUTION : Do not damage dielectric, braid and inner conductor of cable.


CAUTION : Slide body A onto cable.

(use of sliding means recommended)

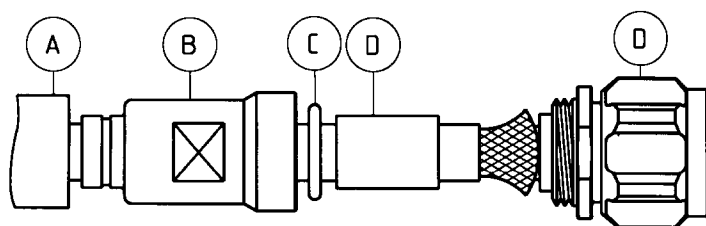

Splay out braid and insert cable in connector body E.


Ensure that braid lies above the crimp neck.

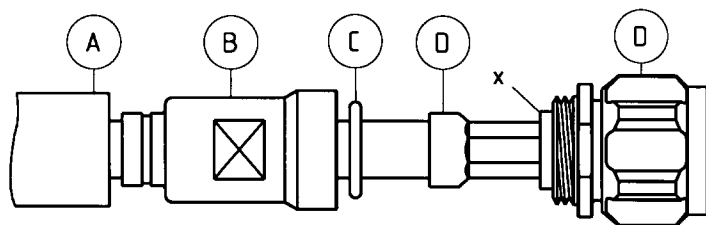

Slide ferrule D over braid and crimp as close to connector body E as possible.

Slide o-ring C over x of body E.

Screw together body parts B and E.

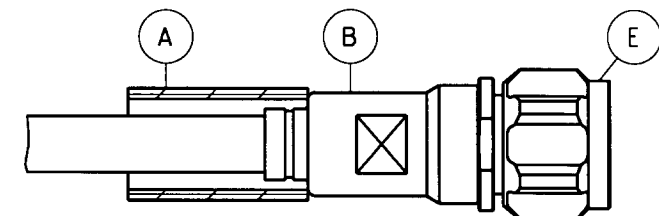

Slide shrink-tube A over body B and shrink it by heating.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F. lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text siehe Rückseite