

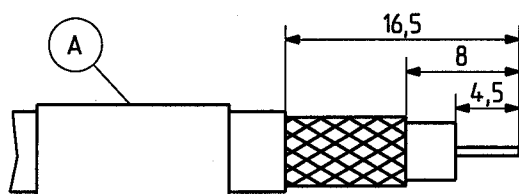
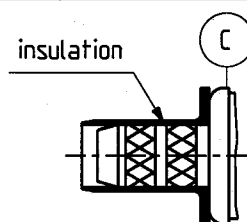
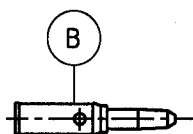


Assembly instruction Series BNC AA 13.02.99 4515/H.G. No.27332


Tools and materials required: Stanley blade Scissors Crimp tool (see table below)	Straight connectors for flexible cable	
	Cable entry: SUHNER Full-Crimp	
	Connector types: (e.g.) 11 BNC-50-3-25	
This connector is supplied in 3 parts	Suitable cables e.g.:	RG 58 C/U
	Centre contact:	cavity 2
	Braid:	cavity B
	Crimp tool:	2B (orange)

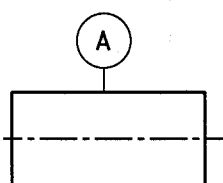


Slide ferrule A onto cable.
Prepare cable according to diagram.
CAUTION: Do not damage braid, dielectric and inner conductor of cable!

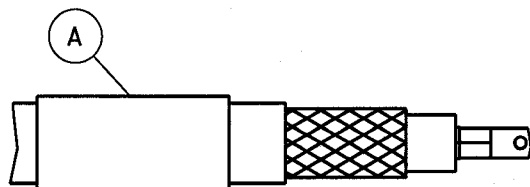

Push contact B over inner conductor of cable to abut dielectric and crimp.

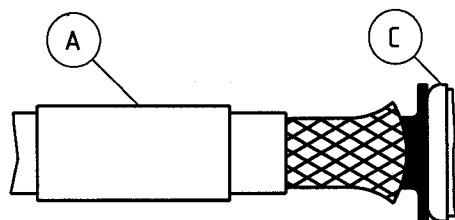

Splay out braid and insert cable in connector body C.
Ensure that braid lies above the insulation.

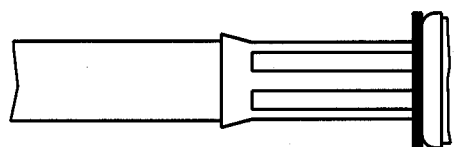

Slide ferrule A over braid and crimp as close to connector body C as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F.lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text: siehe Rückseite