

Assembly instruction

Series MMBX

AB 27.06.00
4540/PM

No.27350

Tools and materials required:

Stanley blade
Scissors
Crimp tool (see table below)

Straight connectors for flexible cable

Cable entry: crimped

Connector types: (e.g.)

11 MMBX-50-1-1

This connector
is supplied
in 3 parts

Suitable cables e.g.:

RG 178 B/U

Centre contact:



 
 
cavity 0,54

Braid:

cavity A

Crimp tool:


76 Z-0-1-1 / 76 Z-0-1-2

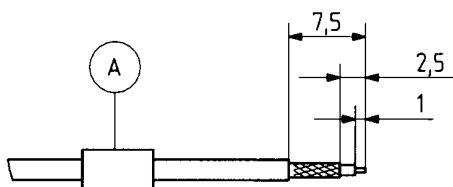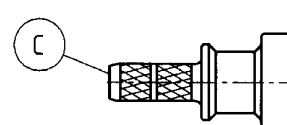


Slide ferrule A onto cable.

Prepare cable according to diagram.

CAUTION: Do not damage braid, dielectric and inner conductor of cable!

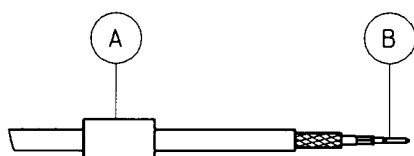


Push contact B over inner conductor of cable to about cable-dielectric and crimp with insert 0,54.

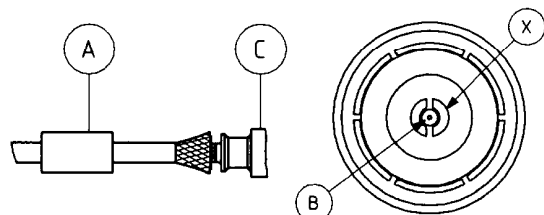

Splay out braid and insert cable in connector body C.

Check : Inner centre contact B have to be in the jack !

Ensure that braid lies above the crimp neck.

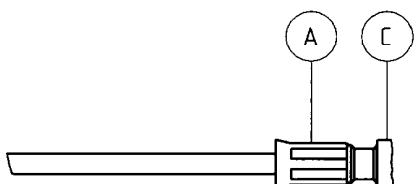

Slide ferrule A over braid and crimp

as close to connector body C as possible.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F. lead-assembly on your behalf.
We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text: siehe Rückseite