

Tools and materials required:

Stanley blade
Scissors
Soldering iron 100 Watts
Solder Sn/Pb 60/40
activated rosin flux
Spanner 16 mm (74 Z-0-0-3)

Angle plug for flexible cable
Cable entry: Screw-type

Connector types: (e. g.)

16 N-50-5-2c

16 N-50-7-9c

This connector
is supplied
in 6 parts

Suitable cables e. g.:
Centre contact:
Braid:

RG 6 A/U



soldered

screwed


RG 214/U

soldered


screwed

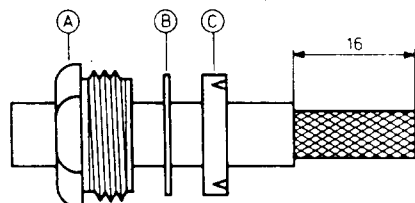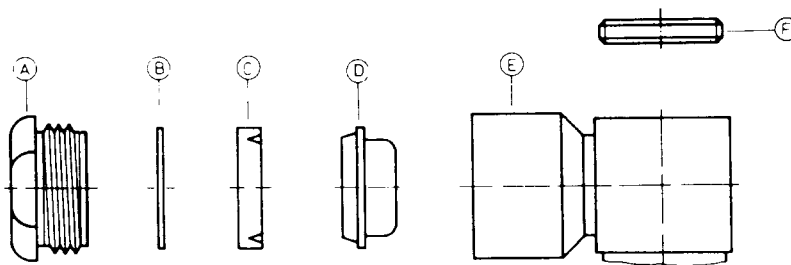


Slide nut A, washer B and gasket C onto cable.
Prepare cable according to diagram.
CAUTION: Do not damage braid!

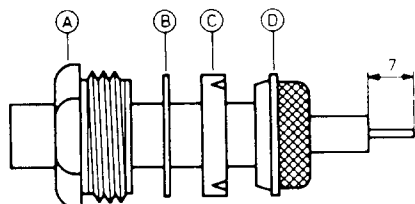

Position braid clamp D so that its shoulder fits against
cable sheath.
Fold back braid over clamp D and trim overlapping braid.
Cut back dielectric 7 mm perpendicular to cable axis.

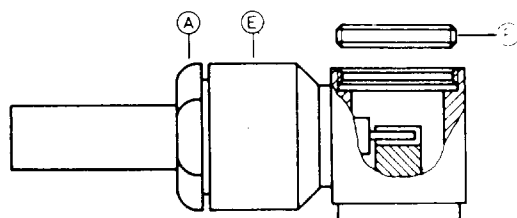

 Push prepared cable into connector body E,
and tighten nut A.
Do not rotate cable in connector body.
Solder inner conductor to contact and screw in cover F.
(torque 11 Nm)



SUHNER's skilled staff and specialised equipment are available to carry out complete R.F. lead-assembly on your behalf.
We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER+SUHNER LTD. CH-9100 HERISAU

Deutscher Text: siehe Rückseite