

Assembly instruction

Series N/C

No. 3063

Tools and materials required:

Stanley blade

Scissors

Crimp tool (see table below)

Straight connectors for flexible cable

Cable entry: SUHNER Full-crimp

Connector types: (e. g.)

11N-50-3-8c

11N-50-4-4c

21N-50-3-7c

21N-50-4-3c

11C-50-3-7c

11C-50-4-5c

This connector is supplied in 3 parts

Suitable cables e. g.:

Centre contact:

Braid:

Crimp tool:

RG 58C/U

cavity 2

cavity B





2 B (orange)

RG 59B/U


cavity 2

cavity C

  
2 C (yellow)

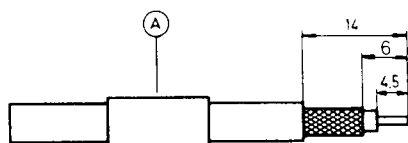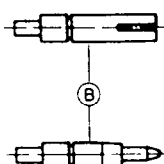


Slide ferrule A onto cable.
Prepare cable according to diagram.
CAUTION: Do not damage braid and inner conductor of cable!

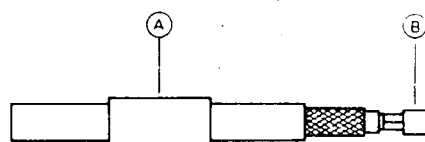


Push contact B over inner conductor to abut cable dielectric and crimp.

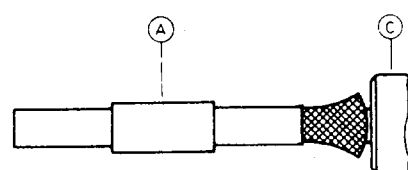

Splay out braid and insert cable in connector body C until contact B engages perceptibly.
Ensure that braid lies above the crimp neck.

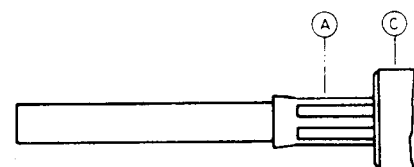

 Slide ferrule A over braid and crimp as close to connector body C as possible.



SUHNER's skilled staff and specialised equipment are available to carry out complete R. F. lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER+SUHNER LTD. CH-9100 HERISAU

Deutscher Text: siehe Rückseite