

Assembly instruction

Series MMCX S 11 No.9175

Tools and materials required:

Stanley blade,
scissors
Crimp tool (see table)
Assembly tool 74 Z 0-0-225

Connector for flexible cable

Cable entry: soldered

Connector types: (e. g.)

16 MMCX 50-1-1c	16 MMCX 50-1-2c
-----------------	-----------------

This connector
is supplied
in 3 parts

Suitable cables e. g.

RG 178 B/U

K 01152-7

Centre contact: captive

soldered





soldered

Braid:

cavity 2,67

cavity 2,67

Crimp tool:

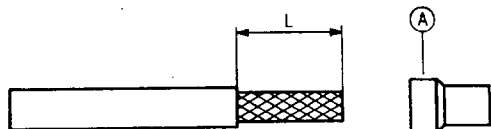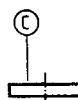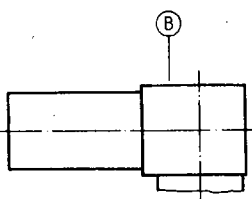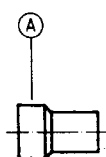

Prepare cable according to diagram.


Connector types

L

16 MMCX 50-1-1c	5,5 mm
16 MMCX 50-1-2c	4,0 mm


Slide braid ferule A over the braid until shoulder abuts the cable sheath.

Fold back braid over ferule A and trim overlapping braid.

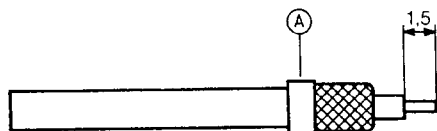


Prepare cable according to diagram.

Do not damage braid and inner conductor of cable!

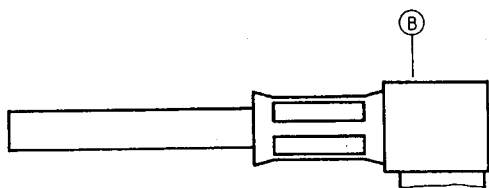

Insert cable into body, and crimp the body B.

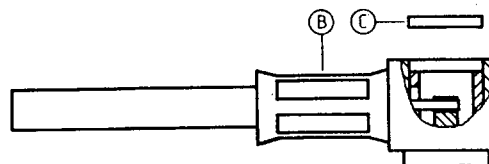

Solder inner conductor to contact.

Place cover C on rear opening of body B.

Press cover C into housing B with assembly tool.



SUHNER's skilled staff and specialised equipment are available to carry out complete R. F. lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER+SUHNER LTD. CH-9100 HERISAU

Deutscher Text: siehe Rückseite