

Assembly instruction Series TNC No. 27216

Tools and materials required :

Stanley blade
Scissors, screw driver
Crimp tool (see table below)
Soldering iron
Solder

Right angle plugs for flexible cables

Cable entry : crimped

Connector types : (e.g.)

16 TNC 50-2-7

This connector
is supplied
in 3 parts

Suitable cables : (e.g.)

K 02252 D

Centre contact :



 

 
soldered

Braid :

cavity A

Crimp tool :


1,2 A (red)

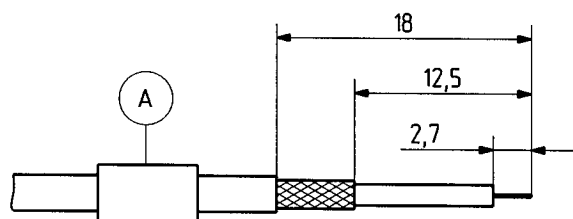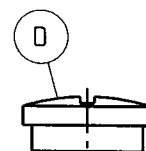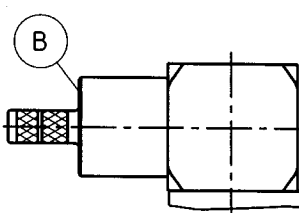

Slide ferrule A onto cable.


Prepare cable according to diagram.

CAUTION : Do not damage braid, dielectric and inner conductor of cable.

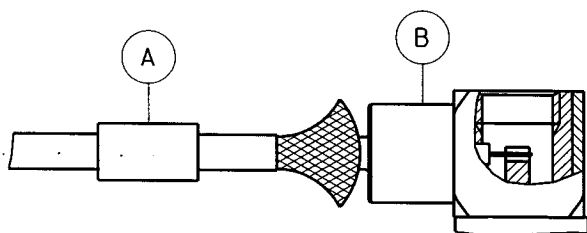

Splay out braid and insert cable in connector body B.

CAUTION : Ensure that braid lies above the crimp neck.

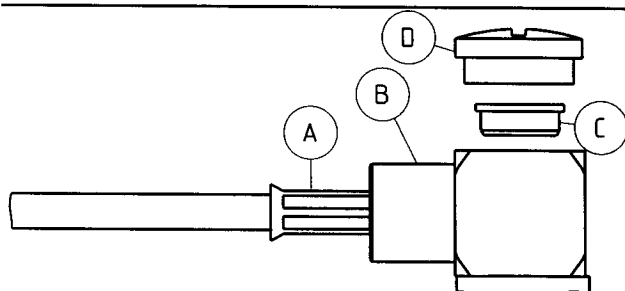

Slide ferrule A over braid and crimp as close to connector body B as possible.

Solder inner conductor to contact, press in disc C and screw in cover D.

SUHNER's skilled staff and specialised equipment are available to carry out complete R.F.lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER + SUHNER AG CH-9100 HERISAU

Deutscher Text siehe Rückseite

Montageanleitung Serie TNC

Nr. 27216

Benötigte Hilfsmittel :

Stanley – Messer
Schere, Schraubenzieher
Klemmwerkzeug (siehe Tabelle)
LötKolben
Lötzinn

Winkel-Kabelstecker für flexible Kabel

Kabeleinführung : geklemmt

Verbinder-Typen : (z.B.)

16 TNC 50-2-7

Dieser Verbinder
wird in 3 losen Teilen
geliefert.

Geeignete Kabel : (z.B.)

K 02252 D

Innenleiter :



 

 
gelötet

Aussenleiter :

Aussparung A

Klemmwerkzeug :


1,2 A (rot)

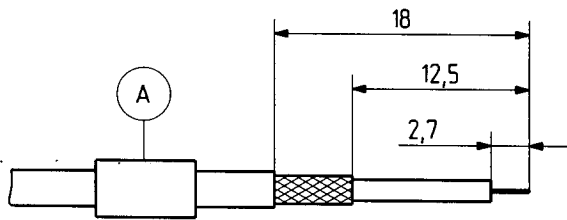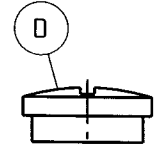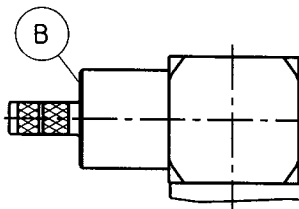

Hülse A auf Kabel schieben.

Kabel gemäss Figur abisolieren.


ACHTUNG: Innenleiter, Abschirmung und Dielektrikum nicht beschädigen.

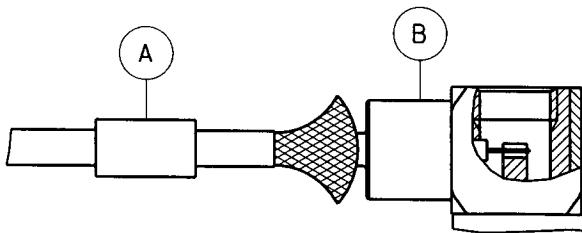

Abschirmung leicht aufspreizen und

Kabel in Gehäuse B einführen.

ACHTUNG: Abschirmung muss über Crimp-
hals liegen!

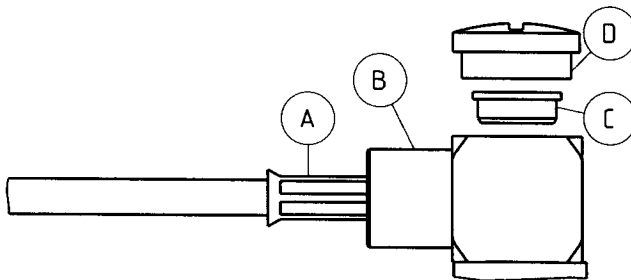

Hülse A über die Abschirmung schieben

und möglichst nahe am Gehäuse B klemmen.

Innenleiter verlöten, Scheibe C hineindrücken
und Deckel D in Gehäuse B einschrauben.

SUHNER verfügt über ausgebildete Fachkräfte und rationelle Einrichtung zur Herstellung kompletter HF-Verbindungs-
leitungen. Wir montieren Ihre Verbinder zu wirtschaftlichen Preisen! Wenden Sie sich an unsere Vertreter.



HUBER + SUHNER AG CH-9100 HERISAU

for English text see overleaf