

EZ-600-NMC (stock code: 3190-355)

Type N-Male Plug

 
Non-solder center contact
clamp-on outer contact

INSTALLATION INSTRUCTIONS

(Cable Types: LMR-600; 600 DB; 600 FR; 600 PVC)



WEATHER
SEAL




CLAMP
NUT




WASHER
(WHEN SUPPLIED)



 GASKET




BRAID
CLAMP

 

CONTACT




CONNECTOR
BODY

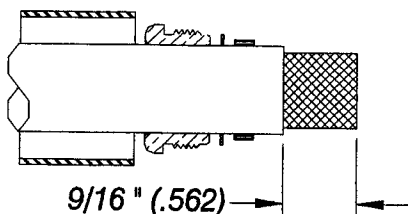

9/16" (.562)

STEP 1

1. (A) Slide weather seal, clamp nut, washer and gasket onto cable. Cut jacket to dimensions shown.

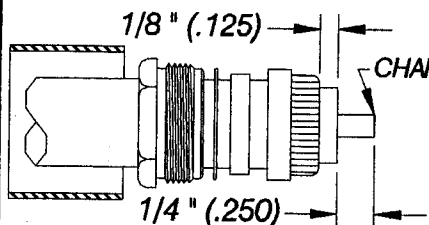


1/8" (.125)

1/4" (.250)

CHAMFER

STEP 2

2. (A) Slide braid clamp over braid. Being certain that clamp seats squarely against cut end of jacket.
- (B) Form braid wires smoothly over clamp as shown and trim off excess wire even with shoulder.
- (C) Cut conductor and dielectric to dimensions shown.
- (D) Remove any residual plastic from center conductor.
- (E) Deburr center conductor using a fine file or Times DBT-01 tool.

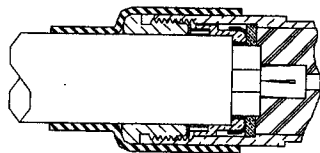

STEP 3

WEATHER SEAL

4. (A) Insert assembly into connector body being certain braid clamp is seated. Tighten clamp nut to 60-65 lbs.-ins. torque.
- (B) Heat shrink weather seal over rear of connector body and down over cable jacket using a hot air gun.