
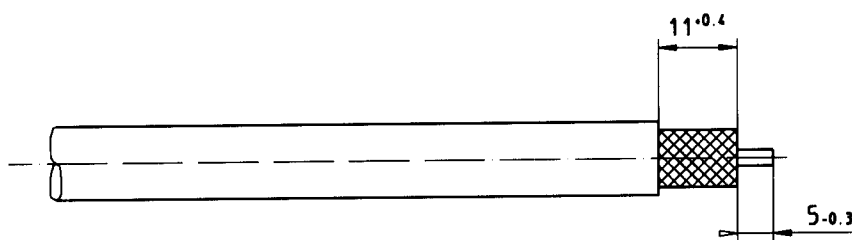
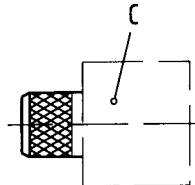
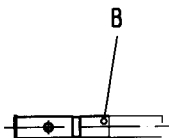


Assembly instruction: 53 012


Series: N

Straight connector
for flexible cable

Cable entry:
Center contact - crimp
Braid - crimp

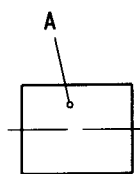


1) Prepare the cable according to the diagram.

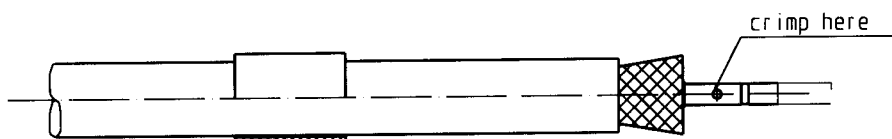

2) Slide ferrule 'A' onto the cable.

3) Push center pin 'B' over the inner conductor of the cable up to the dielectric and crimp it. *)

4) Splay out the braid.

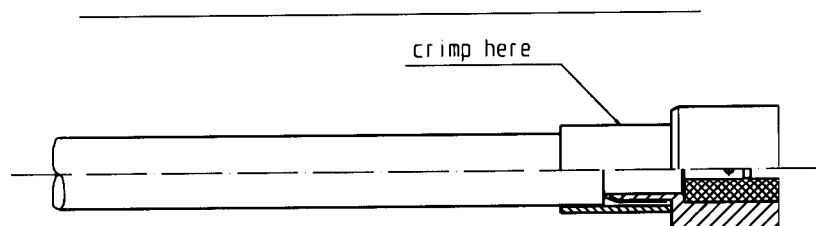

5) Insert the prepared cable into the connector body 'C' until the center pin engages perceptibly. Ensure that the braid covers the knurled connector end.

6) Slide ferrule 'A' over the braid up to the connector body and crimp as close to the connector body as possible. *)

*) For the crimping die part-nr. please consult the relevant customer drawing.

hier diese technische Unterlage behalten
wir uns alle Rechte vor (DIN 34)

Rosenberger Hochfrequenztechnik 84526 Tittmoning			
Bearb.	11.02.2000	Lankes W.	M 1:1
Gepr.	14.2.00	L 7	Blatt 1
Zust	Aenderung	Datum	Name

Tools:
Stripping tool
Crimp tool 11 W 150-000

Crimpdie-flats
hexflange 10.7