


Warning. Danger of death through electric shock!

- Must be installed by professional electrician.
- Disconnect power source.
- Cover or shield any adjacent live components.
- Ensure device cannot be switched on.
- Check power supply is disconnected.



1. Loosen the screws on each side
2. Connect the power supply and the load according to the wiring diagram in accordance with the connection cable diagram.
3. Fix the bottom to the selected position with the inflated screw (see figure)
4. Install the top cover of the sensor, then turn on the power and test it.

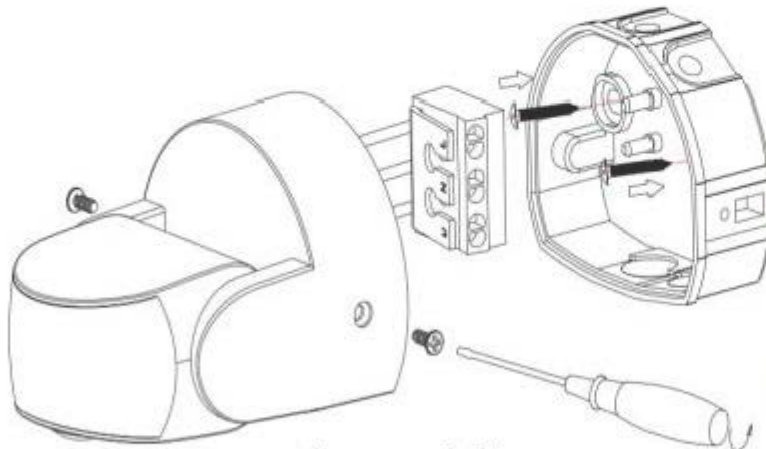