




S/SC/SOV 103 Multipole Plugs

All dimensions see note 1)

S/SC

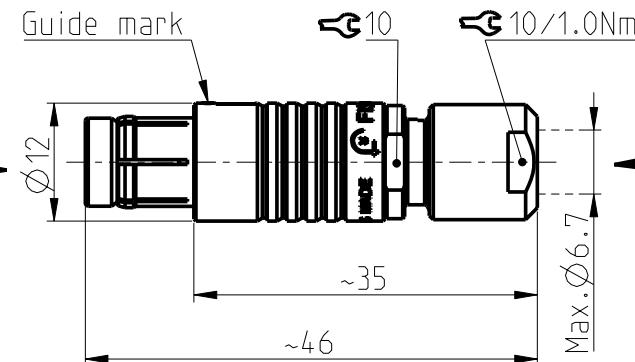


SOV

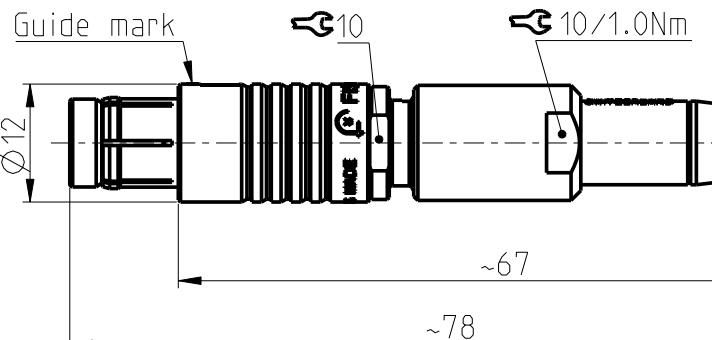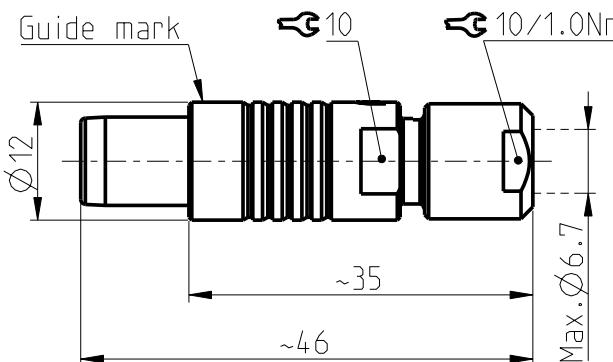


Keying codes (View from F)


Code 1 (-1xx) Code 2 (-2xx) Code 3 (-3xx)

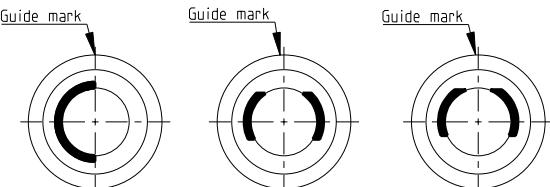

Contact polarity A

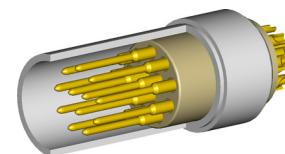


Contact polarity Z

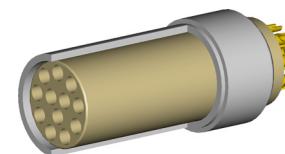


CONTACT CONFIGURATION	Contacts	Solder cup Ø	Crimp cup Ø
103 A Z 051	2	1.18	1.18
103 A Z 052	3	1.18	-
103 A Z 053	4	0.79	-
103 A Z 054	5	0.79	0.80

Contact configuration for polarity A (View from B)


051

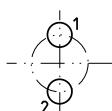


052

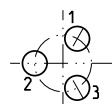





053

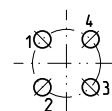

054

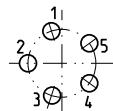

Contact configuration for polarity Z (View from B)

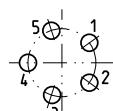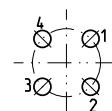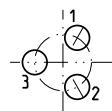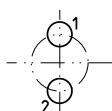

All dimensions in mm

Rev. Pages

600023

1 1/2


Notes :

- 1) All tolerances resulting from connector assembly are typically $\pm 0.3\text{mm}$
 - 2) For optimum crimping refer to available crimping manual.
- Part number example : S 103 A062-130



S/SC/SOV 103 Multipole Plugs

All dimensions see note 1)


S/SC

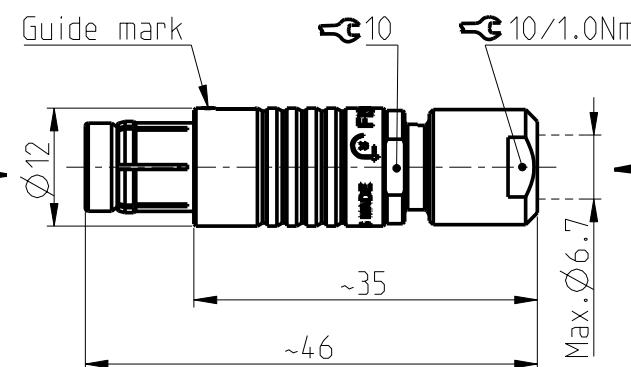


SOV

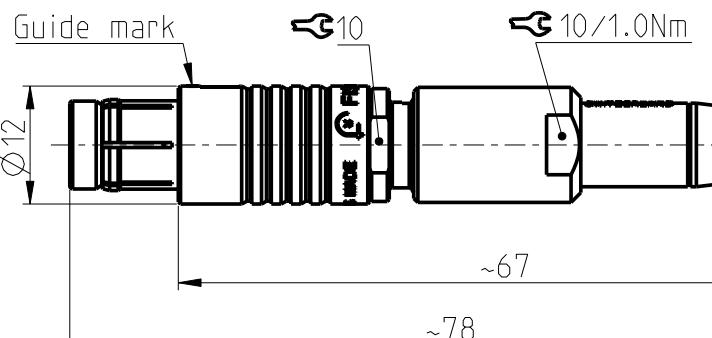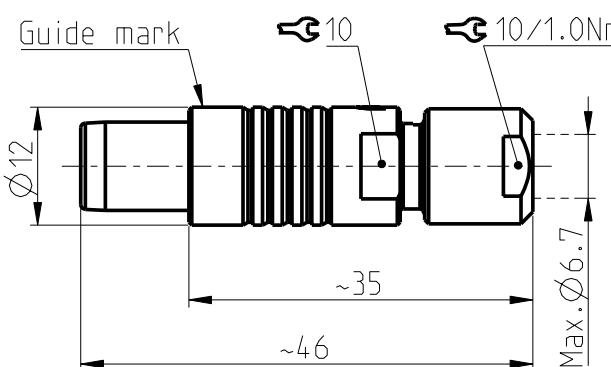


Keying codes (View from F)

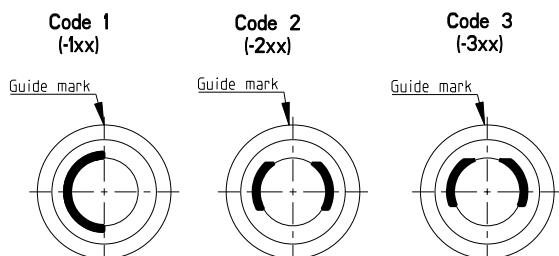

Contact polarity A

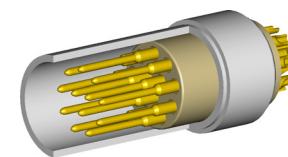


Contact polarity Z

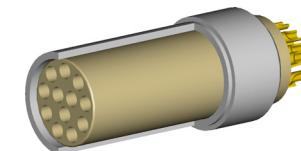


CONTACT CONFIGURATION	Contacts	Solder cup Ø	Crimp cup Ø
103 A Z 056	6	0.79	0.60
103 A Z 057	7	0.79	0.60
103 A Z 058	8	0.79	0.60
103 A Z 062	12	0.43	-

Contact configuration for polarity A (View from B)


056 (3)

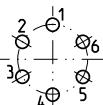

057 (3)

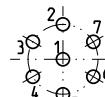

058

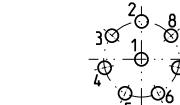


062






Contact configuration for polarity Z (View from B)

(3)

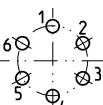

(3)

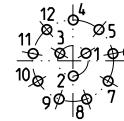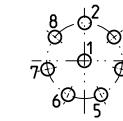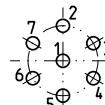

All dimensions in mm

Rev. 1

Pages 2/2

Notes :

- 1) All tolerances resulting from connector assembly are typically $\pm 0.3\text{mm}$
 - 2) For optimum crimping refer to available crimping manual.
 - 3) Only valid for Code 1. For other codes please contact us.
- Part number example : S 103 A062-130

600023