


APPLICATION SPECIFICATION molex



LANGUAGE


ENGLISH

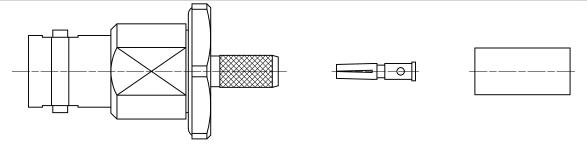


BNC STRAIGHT CONNECTOR

CENTER CONTACT

FERRULE

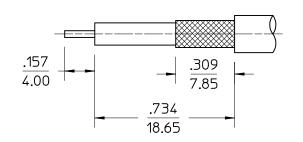


1. STRIP CABLE TO DIMENSION SHOWN.



2. SLIDE SHRINK SUBE AND FERRULE OVER THE CABLE JACKET.

PLACE CONTACT AS SHOWN AND CRIMP USING .067(1.69)HEX OR SOLDER CABLE CENTER CONDUCTOR TO CENTER CONTACT

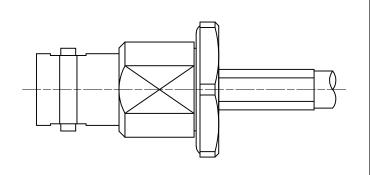

3. FLARE BRAID. INSERT CONTACT/CABLE ASSEMBLY INTO CONNECTOR BODY UNTIL BOTTOMS ON INSULATOR AS SHOWN.

SLIDE FERRULE OVER BRAID AND CRIMP WITH A .213(5.41) HEX

REV	Α																														
SHT	1																														
REVISE ON PC ONLY											TITLE																				
Assembly Instruction A 73597-0039 per ECN RF02-093										CABLE ASSEMBLY INSTRUCTIONS, 73100-0001 BNC-J/PC																					
REV										THIS DOCUMENT CONTAINS INFORMATION THAT IS PROPRIETARY TO MOLEX INC. AND SHOULD NOT BE USED WITHOUT WRITTEN PERMISSION																					
DESIGN CONTROL STATUS MXT						;	WRITTEN BY: LYNN LIN						CHECKED BY:					APPROVED BY:						DATE: YR/MO/DAY 2002/03/21							
DOCUMENT NO. AS-73597-0039														<u> </u>							1	FILE 4S-		ME: 97-	003	- 1	SHT 1	NO. OF	1		