


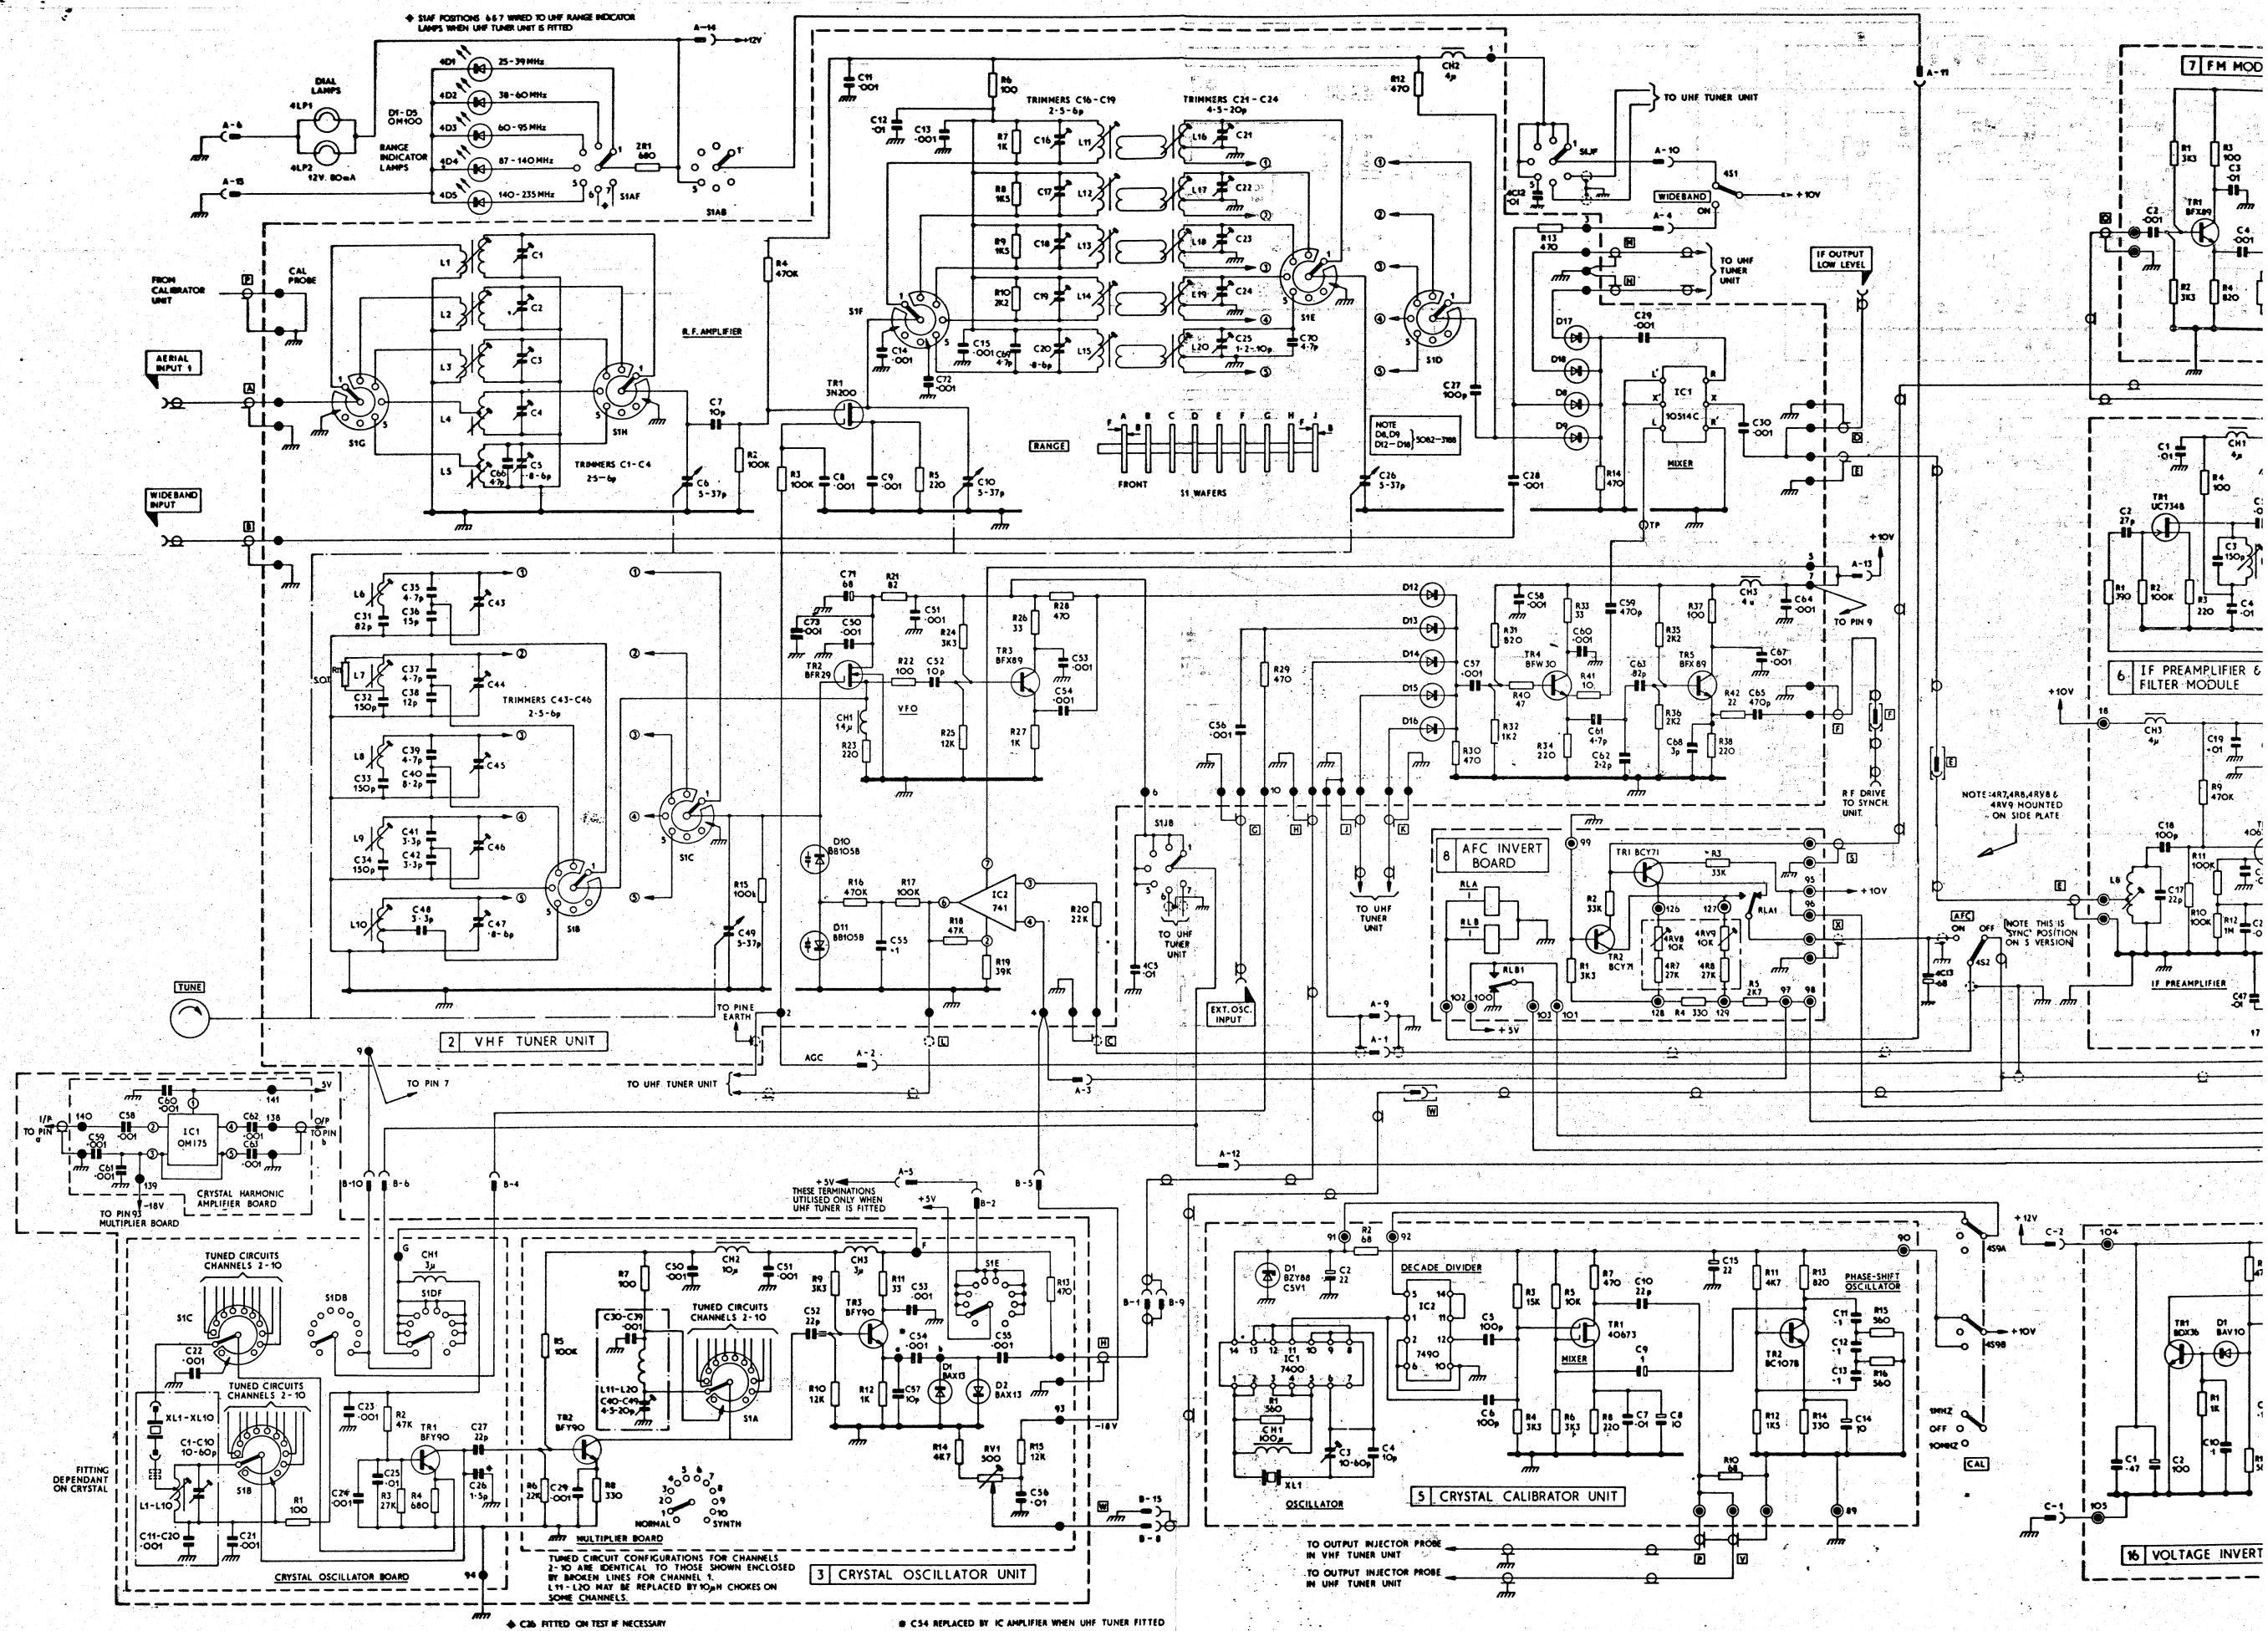
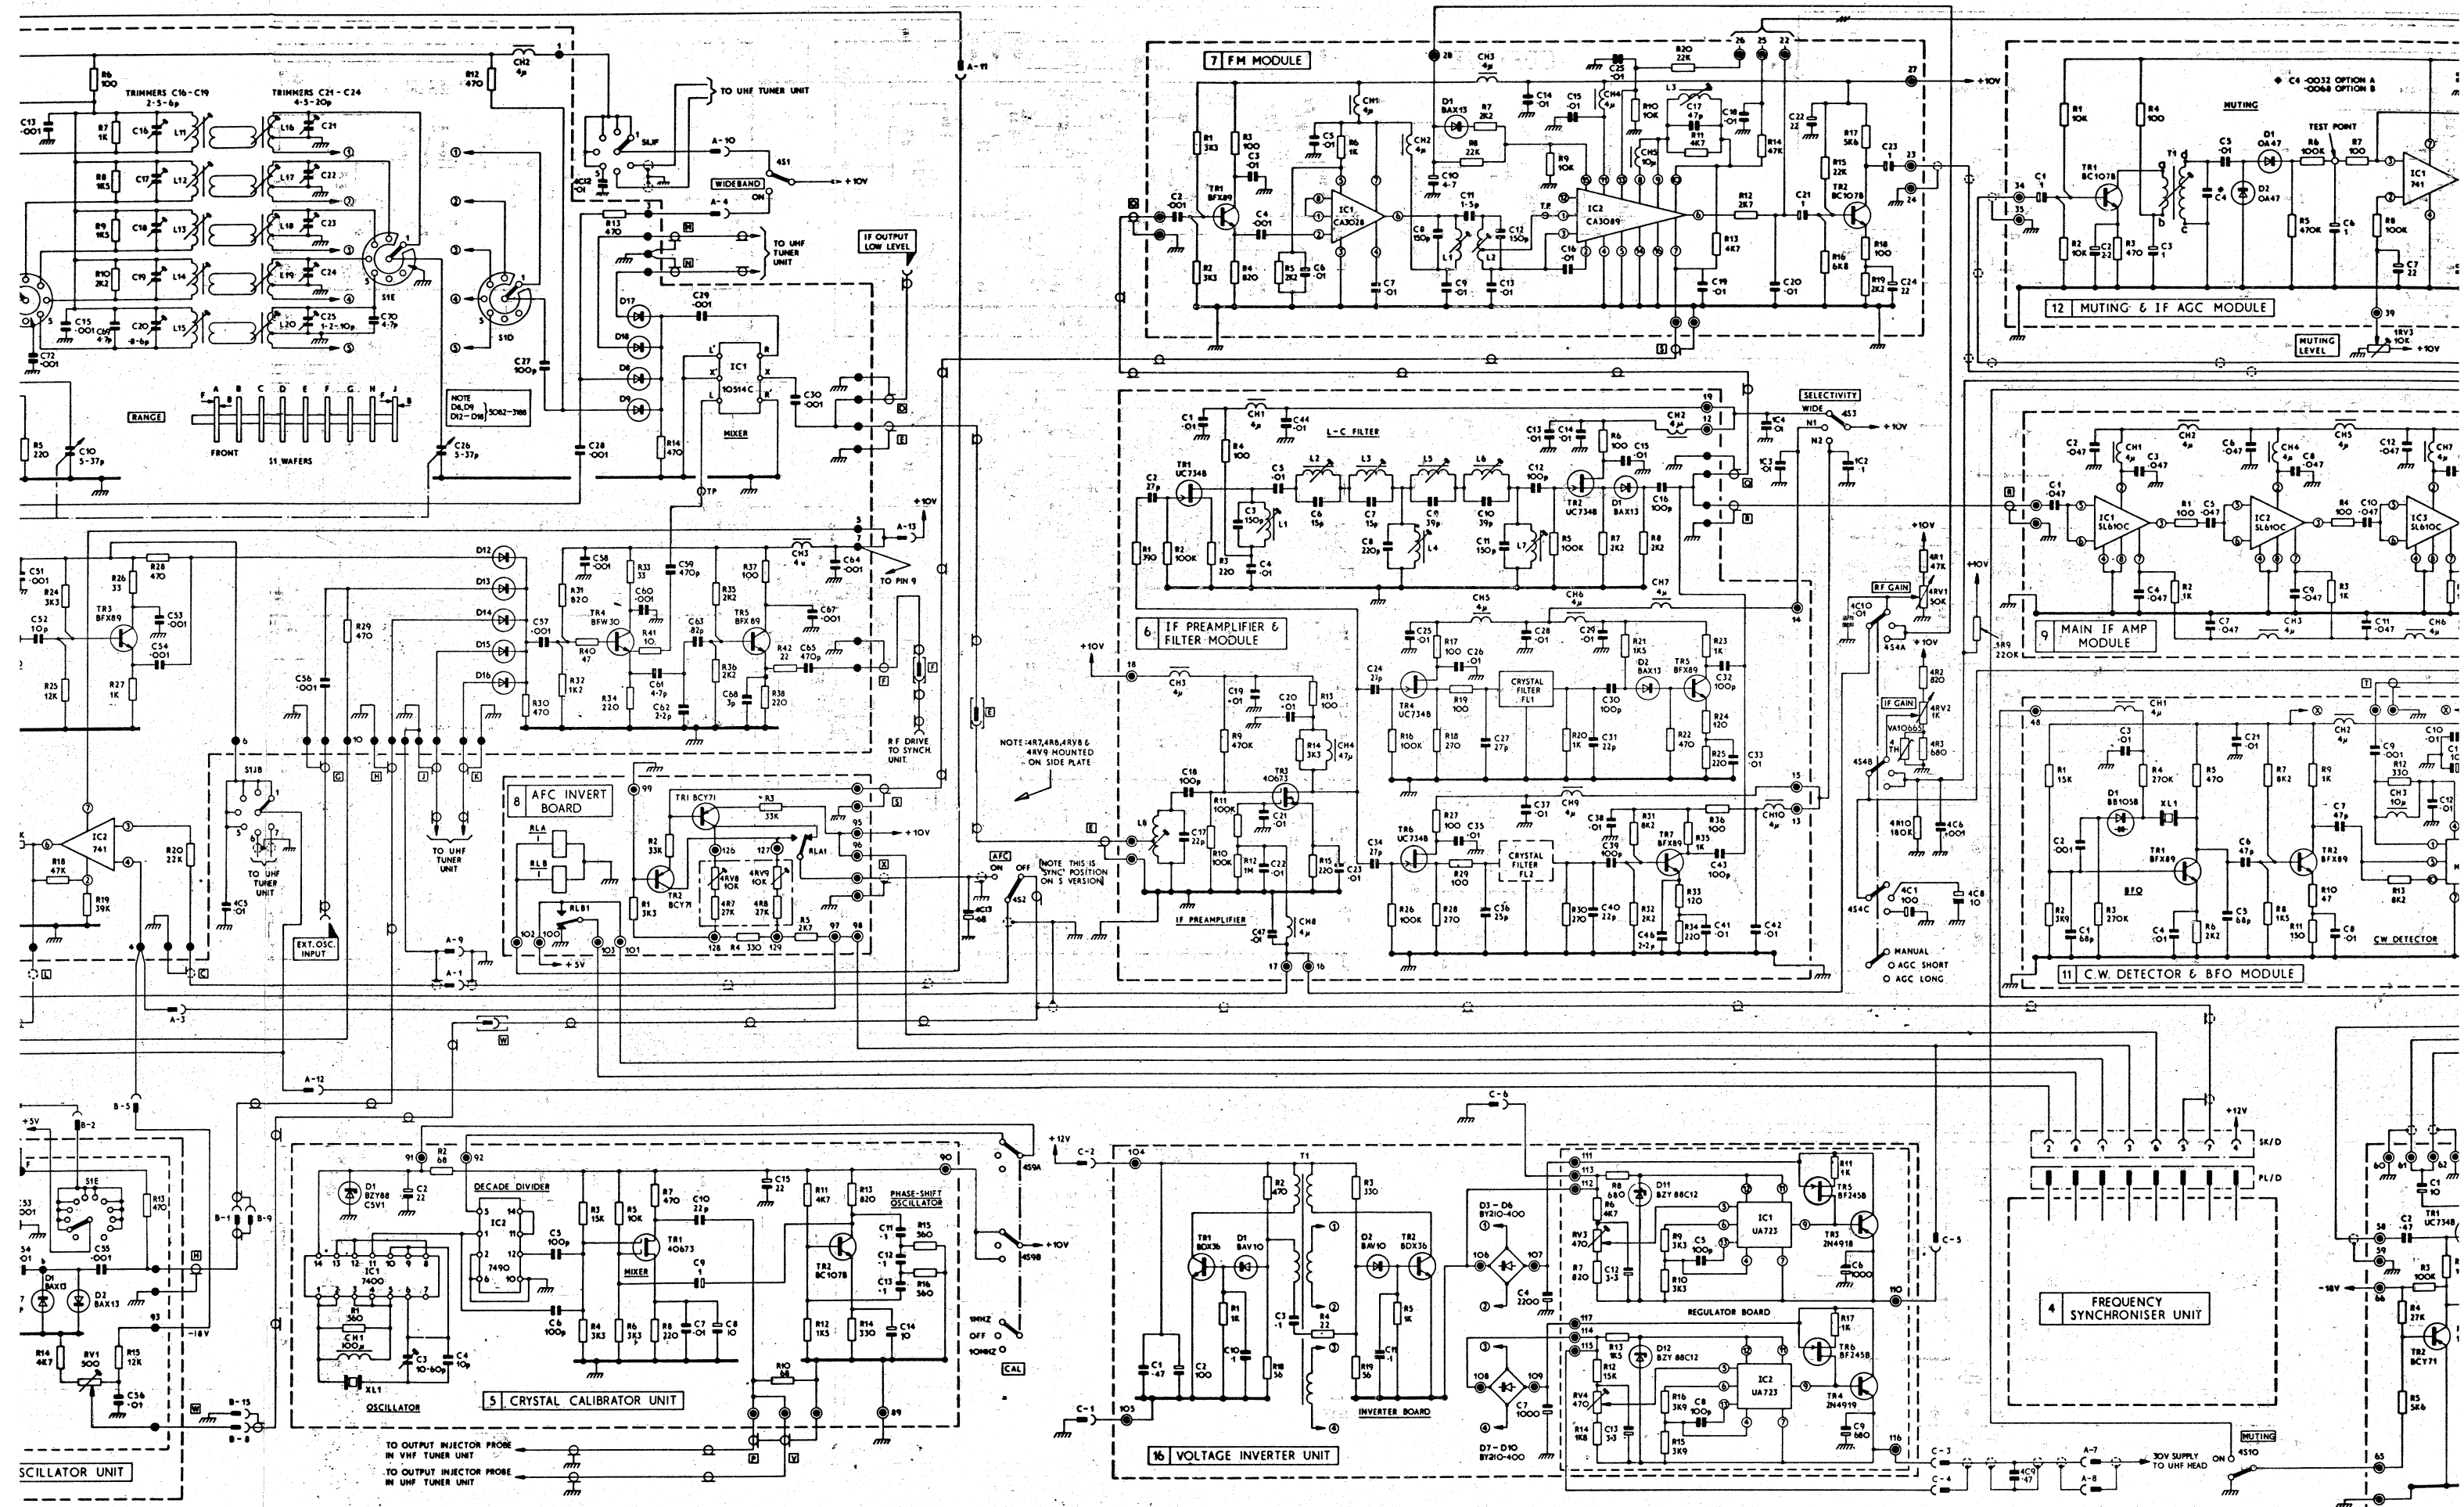
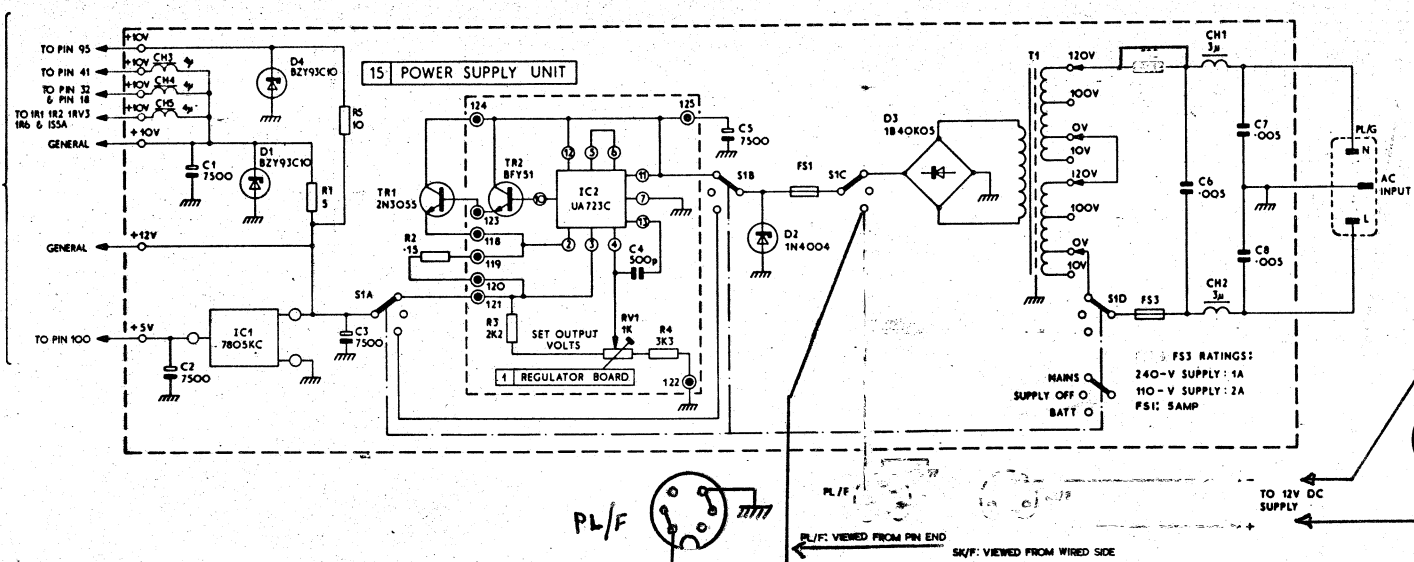


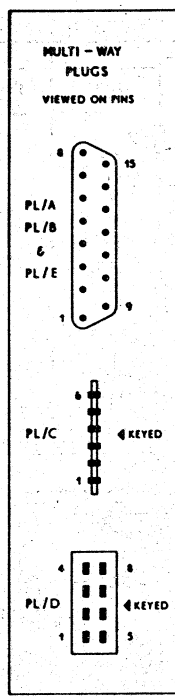

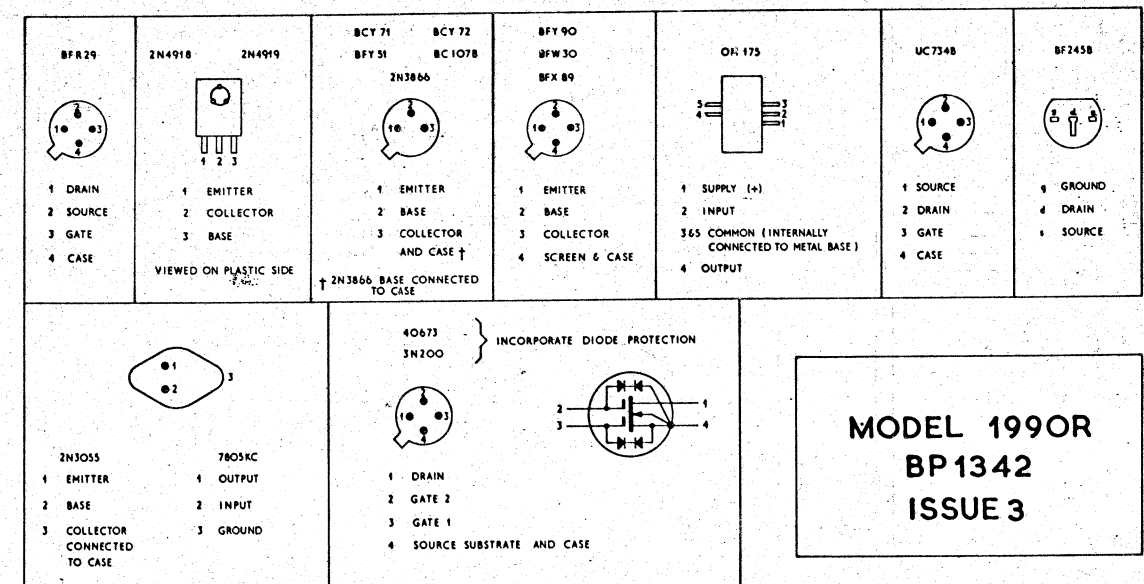


54 REPLACED BY IC AMPLIFIER WHEN UHF TUNER FITTED

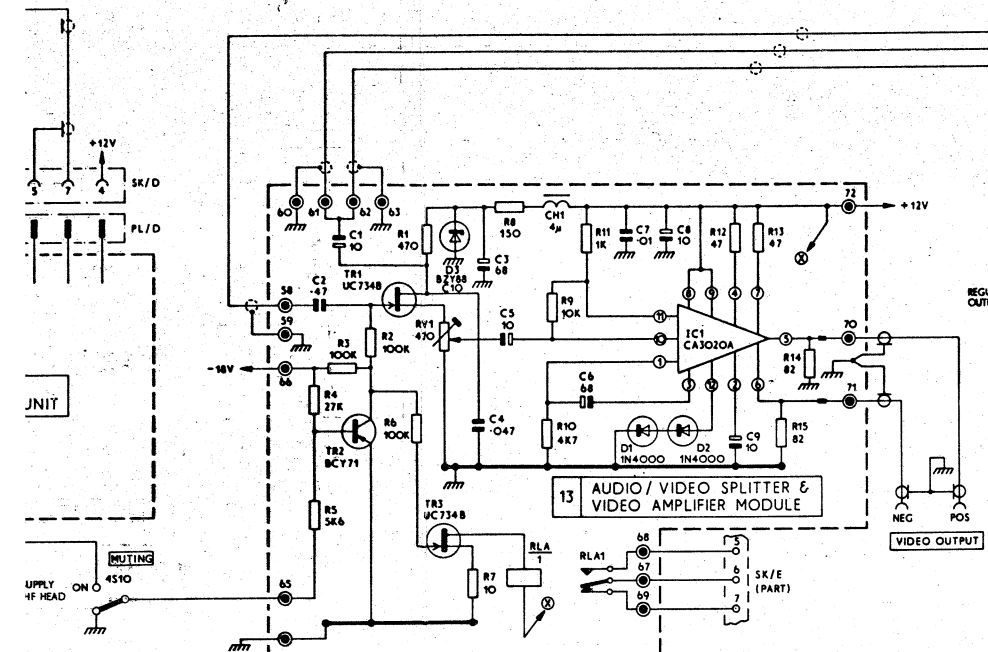


NZPO
Modified
(FS 2
AL/SK/F)

(BULGIN
6 PIN CHASSIS MOUNTING PLUG P427)
AND SOCKET P428

SK/F

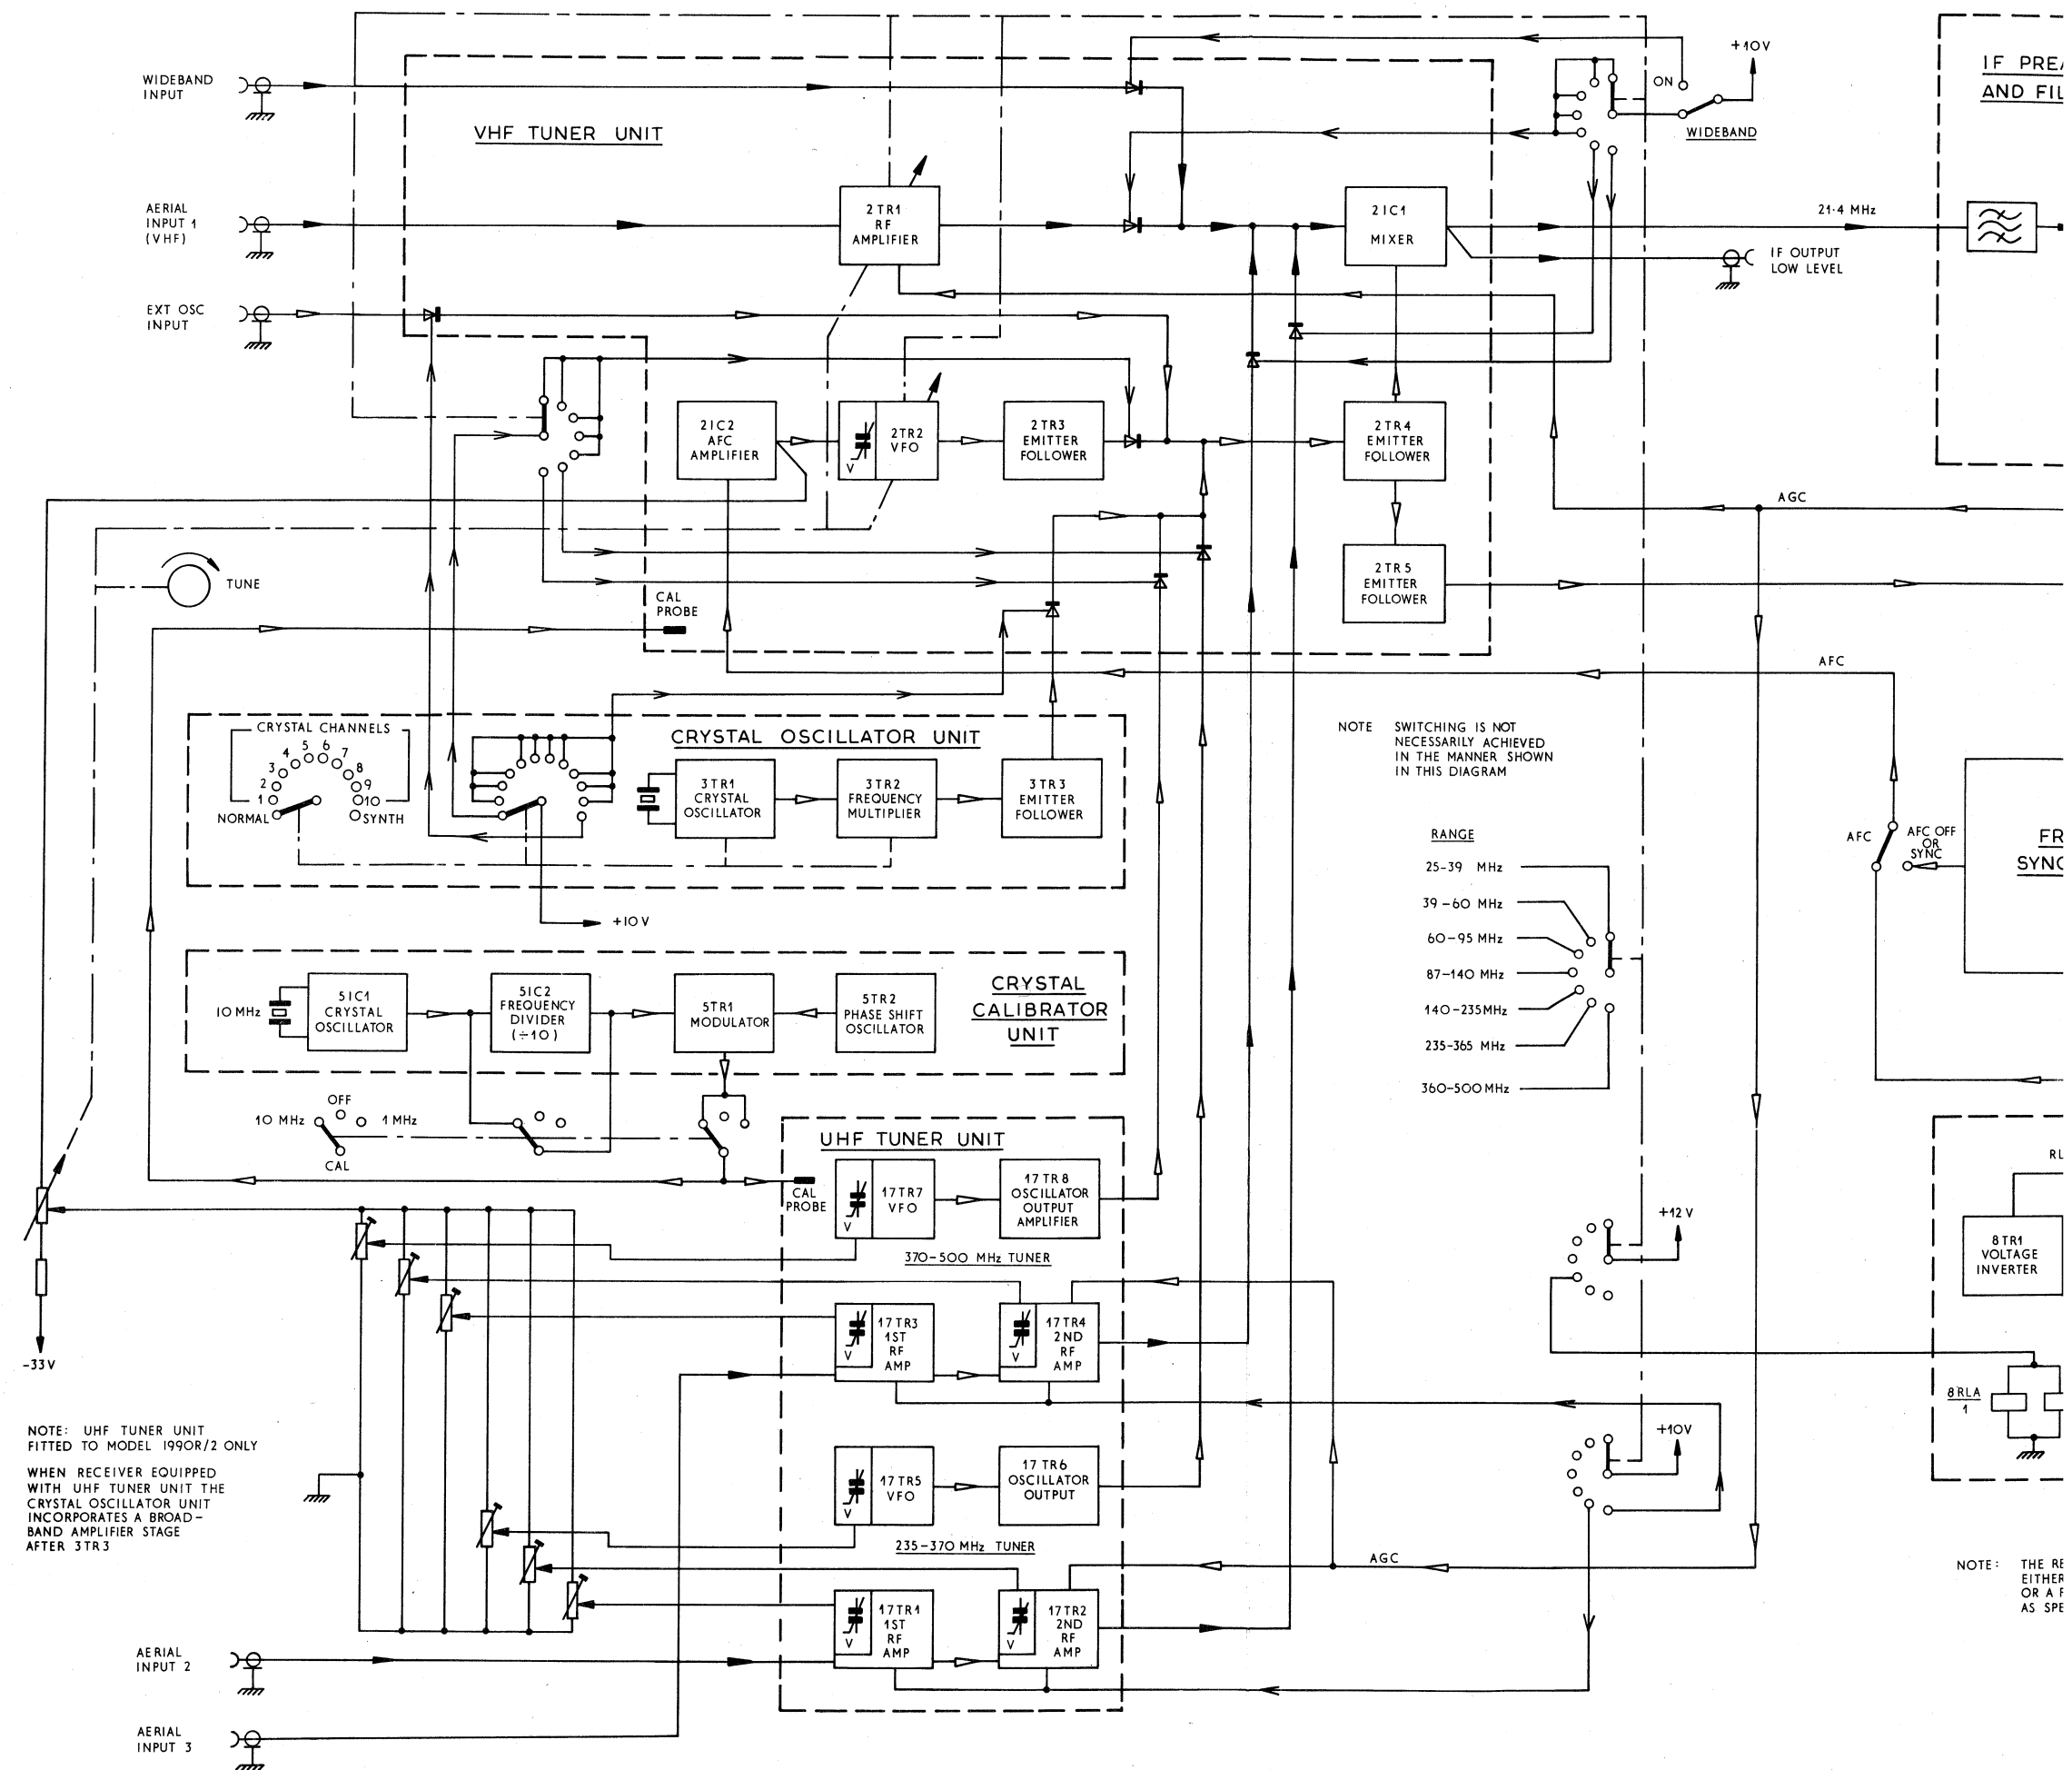


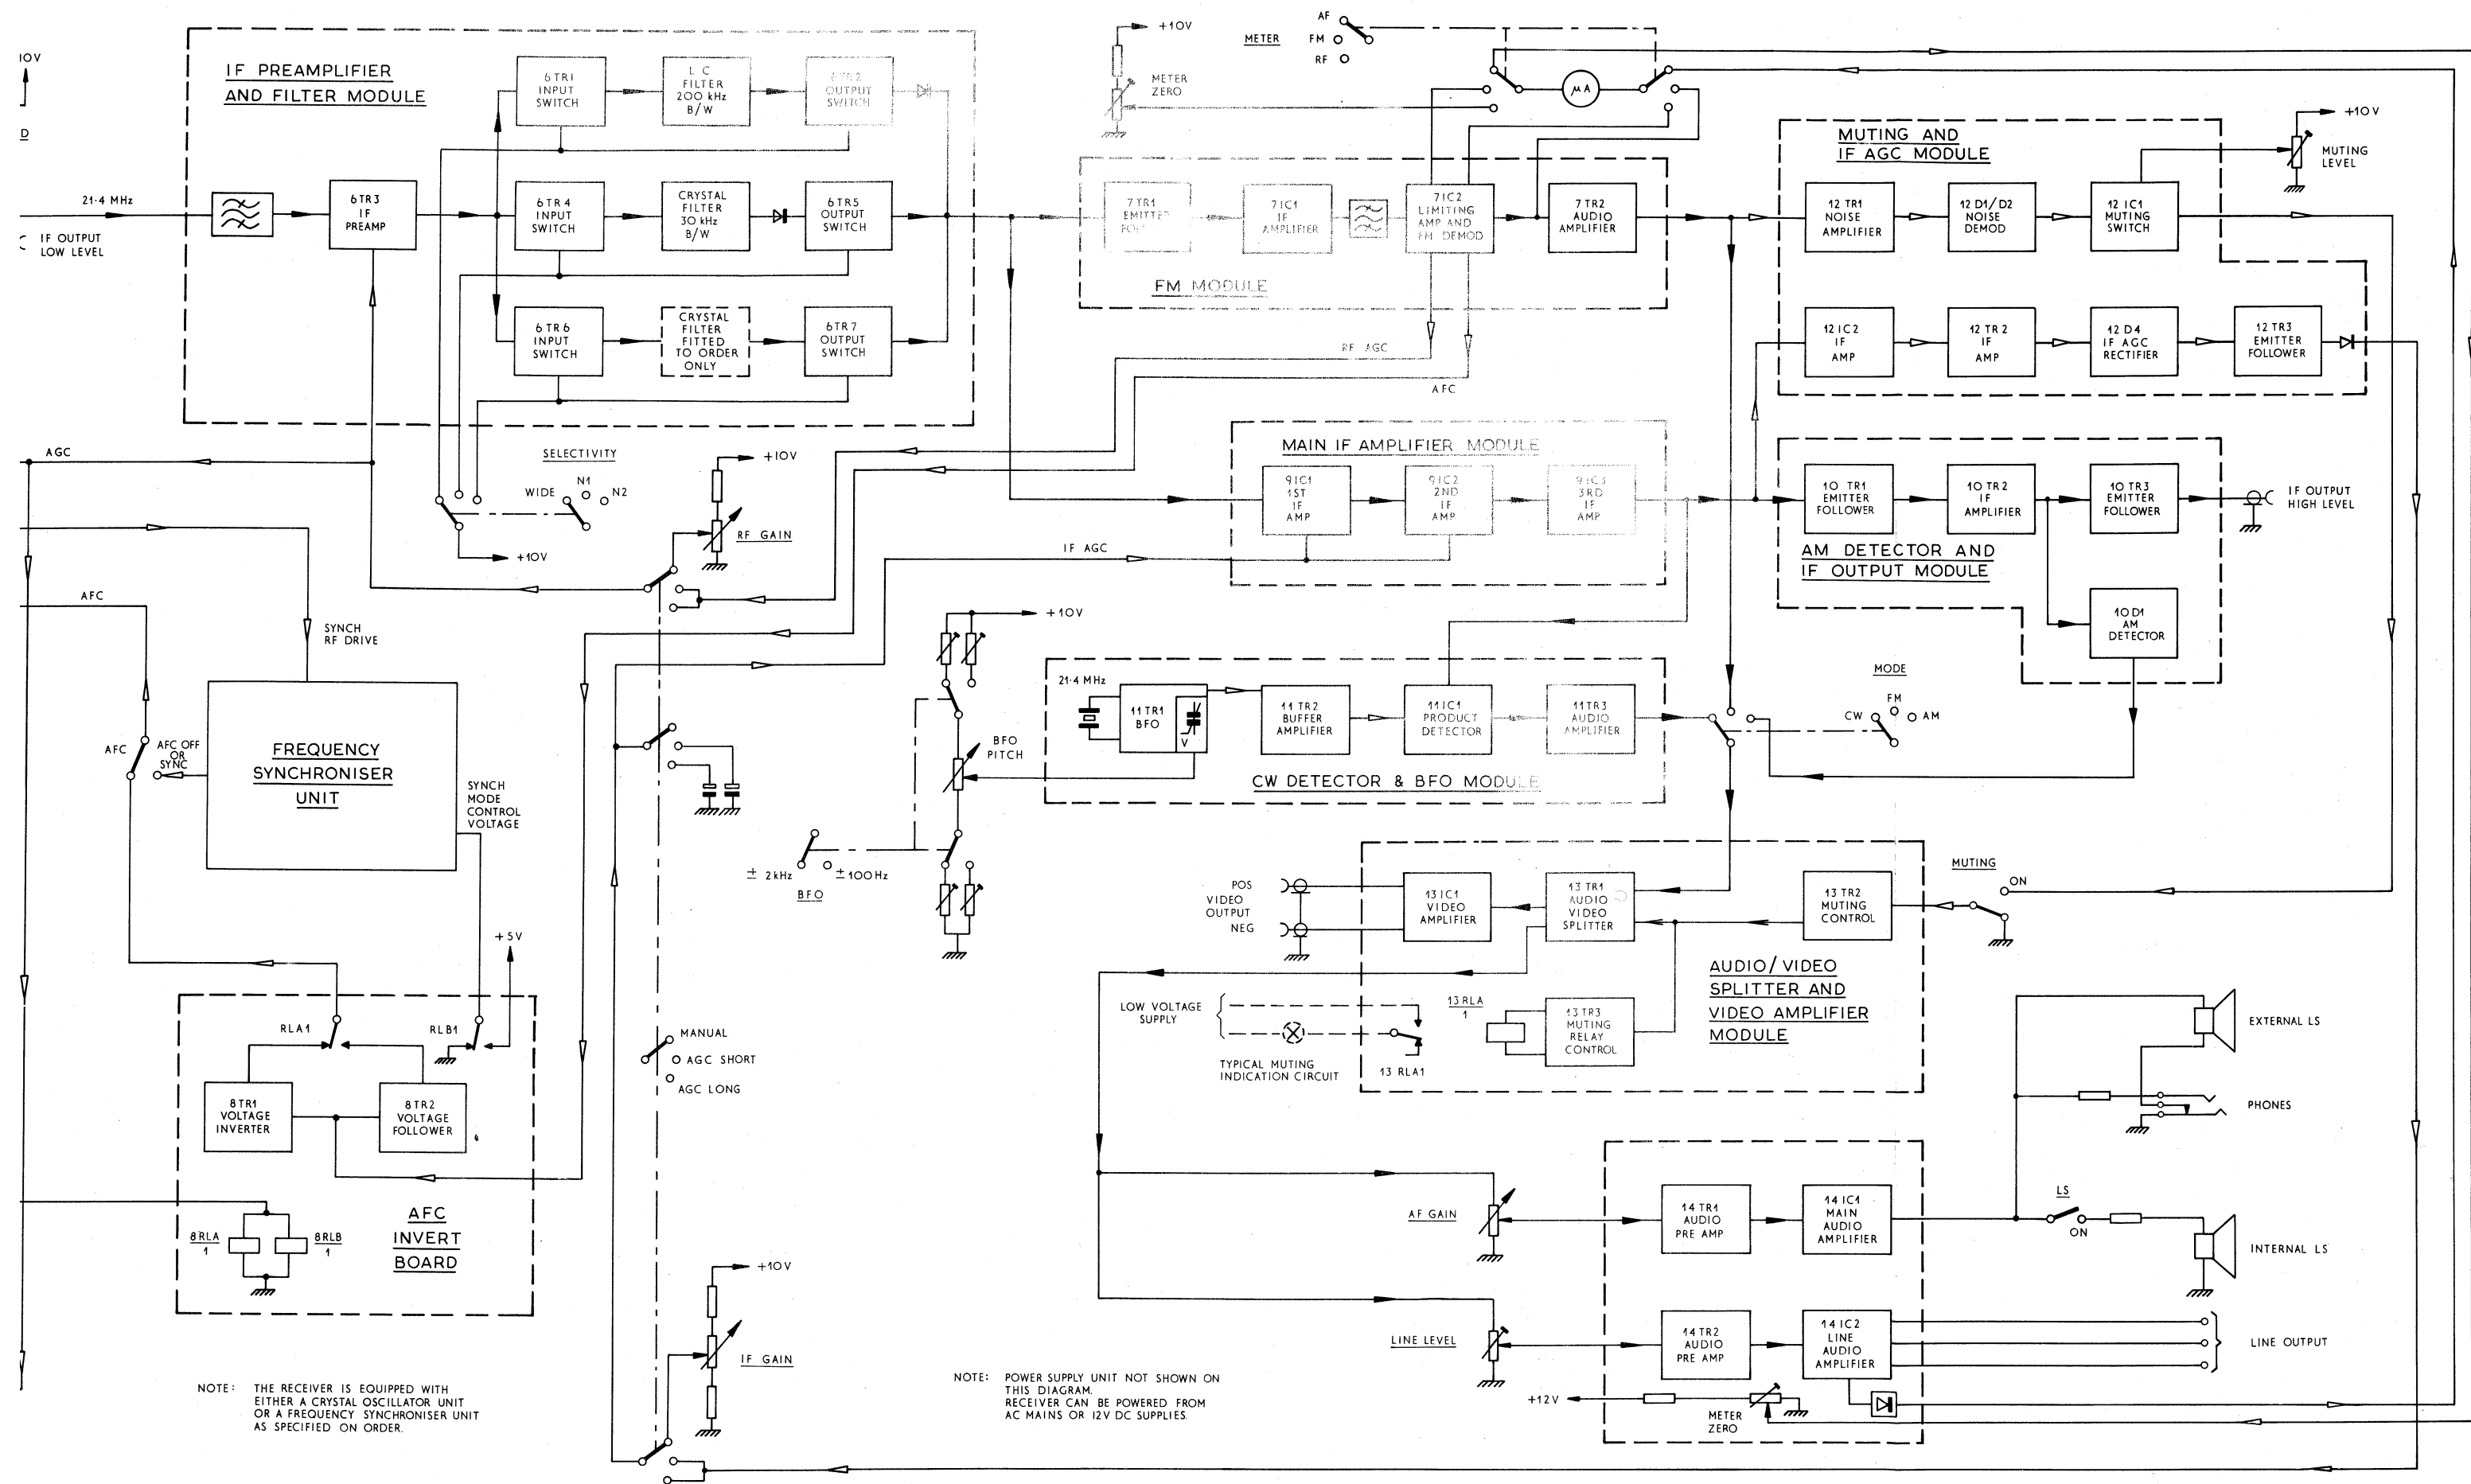


BLOCK DIAGRAM

MODEL 1990R

BP 1354 ISSUE 1

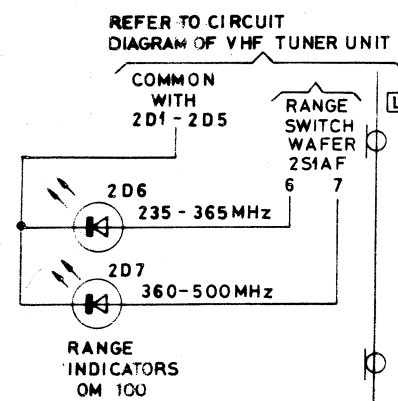


COMPONENTS
MOUNTED ON
VHF TUNER
DRIVE UNIT

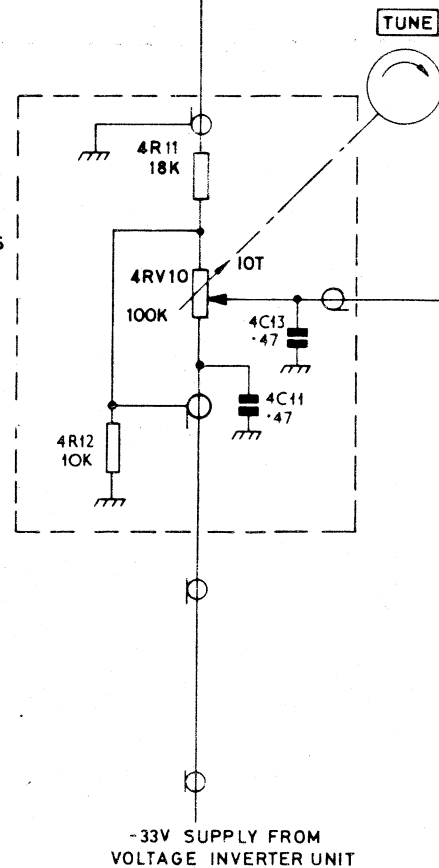


AERIAL
INPUT 2


235 - 365 MHz AMPLIFIER

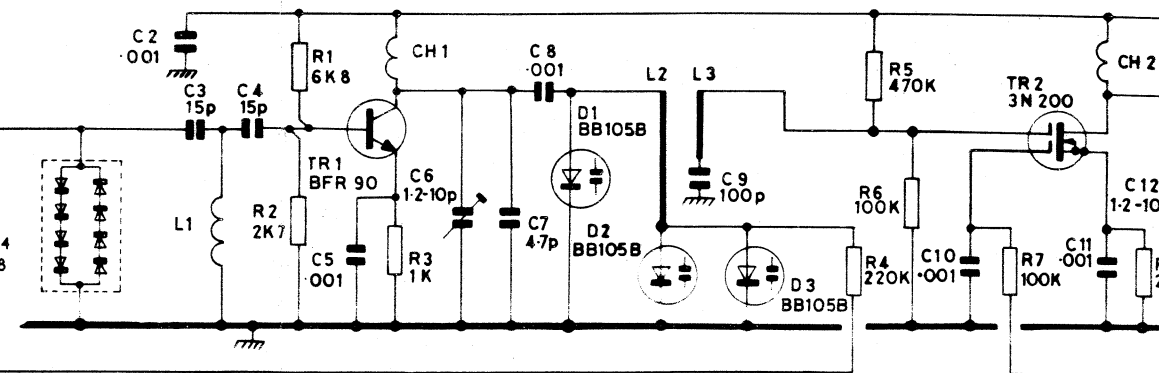


360 - 500 MHz AMPLIFIER

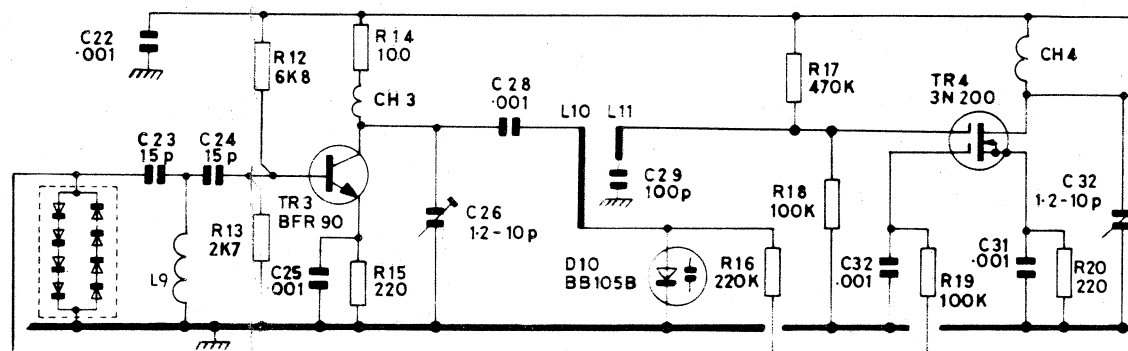

235-365 MHz OSCILLATOR

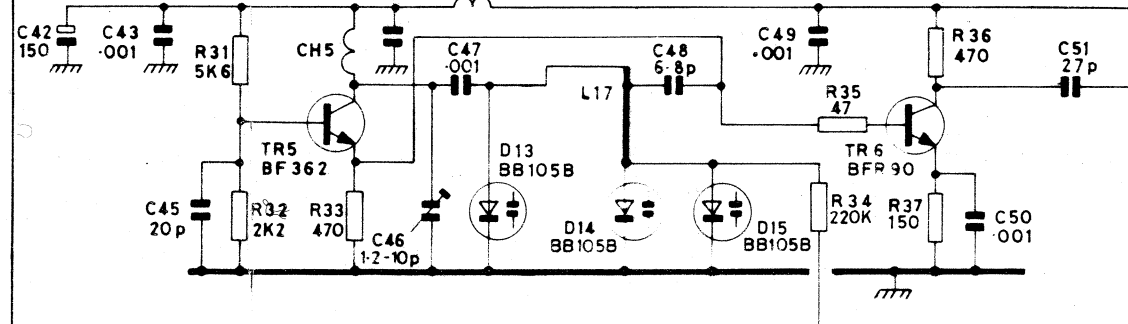

360 - 500MHz OSCILLATOR

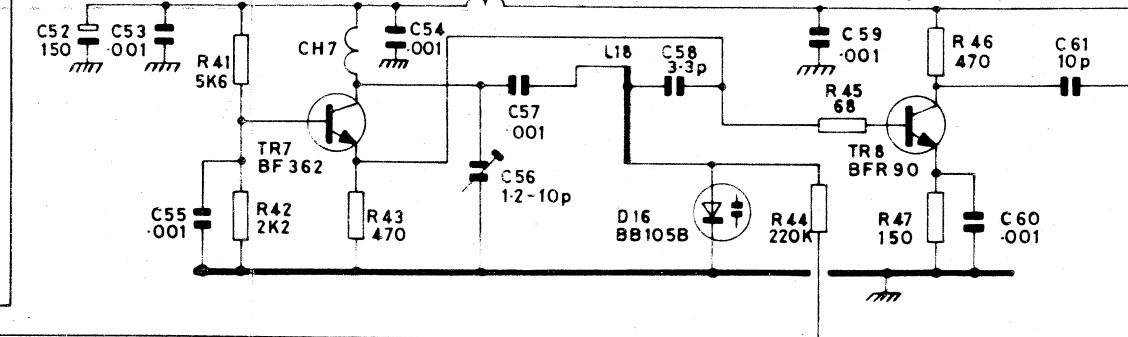

AERIAL
INPUT 3

